



Technical Service Bulletin

93 Combined software update Audi e-tron GT

93 24 77 2073768/1 July 26, 2024

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
e-tron GT, and RS e-tron GT	2022 - 2024	All	Not Applicable

Condition

NOTICE

This bulletin is only applicable if referred to by another TSB. When submitting claims to warranty, both bulletins should be noted in the claim comments, or claims may be denied.

Technical Background

Not applicable.

Production Solution

Not applicable.

Service

CAUTION

Applies to vehicles with high-voltage components:

- To prevent the high-voltage battery from charging during the software update, the high-voltage charging cable on vehicles with high-voltage components must be unplugged BEFORE the SVM code is entered.
- Please note that charging the high-voltage battery during a software update can cause damage to the high-voltage components.

NOTICE

It is recommended to use a battery charger with a current rating of at least 90A. The battery charger must be switched off and on once before starting.



Technical Service Bulletin

VAS tester with the current version of ODIS.

NOTICE

Always use DoIP when flashing a control module via ODIS in supported vehicles.

- **To activate DoIP, select *Administration>>General>>GFF Process>>DoIP communication>>Only allow DoIP communication.***
- ***This setting will automatically reset when the diagnostic session has ended.***

Follow all instructions in TSB → [2011732](#): *00 Software Version Management (SVM), operating instructions.*

Update the Hybrid battery manager (008C) and Comfort control module (0046) using the SVM action code as listed in the table below, if necessary:

Model	Diagnostic Address	Old Software Part Number	Old Software Version	New Software Part Number (or higher)	New Software Version (or higher)	SVM Code Input
e-tron GT	0046	992907064DK	0604	992907064DK	0605	SWVGTA001
		992907064CK	0585		992907064DT	
		992907064CT	0584			
		992907064DT	0604			
	008C	9J1915234AK	1641	9J1915234AT	1646	
		9J1915234AP	1644			
		9J1915234AT	1646			
		9J1915234AR	1645	9J1915234AR	1645	
		9J1915234AL	1643			
		9J1915234AM	1643			
		9J1915234AS	1646	9J1915234AS	1646	
		9J1915234AN	1644			
	9J1915234AJ	1641				

NOTICE

A combined software update will be performed on this vehicle.



Technical Service Bulletin

Please activate bus sleep mode for at least 5 minutes.

Please perform the “Calibrate component protection” function.

Perform position detection for the parking brake if necessary.

On vehicles with 22 kW onboard charger (OBC), the charging profiles must be restored to the factory settings.

Vehicles with 22 kW OBC (PR Number KB4):

Select “Self-test”.

00C6 - High-voltage battery charger - J1050.

00C6 - High-voltage battery charger control module, functions.

C6 - Reset charging timer and charging profiles to factory settings.

Warranty

Please see referring TSB.

Additional Information

All part and service references provided in this TSB (**2073768**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.