



Technical Service Bulletin

93 e-tron GT - red onboard supply fault P0B1300 Hybrid/EV Battery Pack Current Sensor "A"/"B" Correlation in 008C

93 24 79 2074257/1 July 26, 2024.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
e-tron GT, and RS e-tron GT	2022 - 2024	All	Not Applicable

Condition

Customer statement:

In the instrument cluster, the red onboard supply warning is shown with the text "Electrical system: fault. Safely stop vehicle".

Workshop findings:

The customer statement can be reproduced.

In diagnostic address 008C, among others, the event memory P0B1300 "the event memory entry P0B1300 "Hybrid/EV Battery Pack Current Sensor "A"/"B" Correlation" with symptom number 1048614 is logged as active/static or passive/intermittent.

Software version for BMC Software (008C – hybrid battery management) is either 1641 or 1643 or 1644 or 1645.

Vehicle production date (ZP8) is prior to 15.07.2023.

Technical Background

Software issue.

Production Solution

Not applicable.

Service



NOTICE

The following procedure must be performed if both the customer complaint and workshop findings apply.

Perform the following software update:

Refer to TSB 2073768: *Combined software update Audi e-tron GT.*



Technical Service Bulletin

A software update will be available at a later date for vehicles produced after 15/07/2023. When it is available, this TSB will be updated.

Warranty

The TSB number must always be stated for ease of processing. For markets with DISS-SAGA/2 link, the TSB is taken from the DISS system. For markets without DISS or without DISS-SAGA/2 link, the “HST number” field must be completed in the SAGA/2 system.

If you are billing AUDI AG/the importer according to the warranty guidelines, please note the following accounting instructions:

Service number / damage code: 9325 / 039

Warranty accounting instructions: refer to TSB 2073768

Additional Information

All part and service references provided in this TSB (**2074257**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.