



Technical Service Bulletin

96 "Audi Active Lane Assist/Traffic Jam Assist: malfunction!", DTC U112300 is stored in one of two control modules

96 24 00 2061932/8 July 17, 2024. Supersedes Technical Service Bulletin Group 96 number 24-92 dated February 20, 2024 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4, A4 allroad, S4, A5, A5 Cabriolet, A5 Sportback, S5, S5 Cabriolet, S5 Sportback, RS 5, RS 5 Sportback, Q5, Q5 e quattro, Q5 Sportback, SQ5, and SQ5 Sportback	2021 - 2023	All	Not Applicable

Condition

REVISION HISTORY		
Revision	Date	Purpose
8	-	Revised <i>Condition</i> (updated wording, removed picture) Revised <i>Technical Background</i> (updated statement) Revised <i>Service</i> (removed required measured value check) Revised <i>Warranty</i> (updated warranty table) Revised <i>Required Parts and Tools</i> (removed section)
7	02/20/2024	Revised header (added new model year) Revised <i>Condition</i> (updated frequency counter)
6	10/16/2023	Revised header (updated models and PR code filter) Revised <i>Condition</i> (added frequency requirement) Revised <i>Service</i> (updated diagnosis procedure) Revised <i>Warranty</i> (updated to reflect new diagnosis procedure)

Customer states:

The customer complains about the following messages on the instrument cluster:

"Traffic Jam Assist: unavailable!"

"Audi Active Lane Assist: fault!"

In addition, both functions are unavailable / cannot be activated.



Technical Service Bulletin

Workshop findings:

The complaint is active/static and can be reproduced at any time.

The following DTCs are logged:

Front camera, R242 (address word 00A5):

DTC U112300: Databus error value received (**symptom 1123220**) (active/static).

DTC U112300: Databus error value received (**symptom 1123220**) (passive/sporadic) ([frequency counter >= 5](#)).

Distance regulation control module, J428 (address word 0013):

DTC U112300: Databus error value received (**symptom 2153**) (active/static).

DTC U112300: Databus error value received (**symptom 2153**) (passive/sporadic) ([frequency counter >= 5](#)).

Technical Background

Under analysis.

Production Solution

Not applicable.

Service

Please replace the capacitive steering wheel according to the instructions in the repair manual.

NOTICE	
<p>Try to reproduce the customer complaint (based on the description/cause of the issue), so that it can be clearly assigned to this TPI. The following repair must only be carried out if all the criteria (model/type, chassis number, engine/motor and gearbox code, PR number(s), part number, software version, code etc.) apply exactly. Otherwise, this solution will not eliminate the problem, and repeat repairs may be necessary. In such a case, we may reject the warranty claim and charge back the cost of the parts.</p>	

Warranty

Claim Type:	1If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.
Service Number:	4810
Damage Code:	0040



Technical Service Bulletin

Labor Operations:	Steering wheel remove + reinstall	4810 1900	See SRT with associated operations
	Charge battery	2706 8950	See SRT with associated operations
Diagnostic Time:	GFF	0150 0000	Time stated on the diagnostic protocol
Claim Comment:	As per TSB 2061932/8		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All parts and service references provided in this TSB (**2061932**) are subject to change and/or removal.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.