



# Preliminary Information

## PIC6548 Diagnostic Tip For - Cannot Switch Between Adaptive and Regular Cruise Control or Cruise Control Inoperative After Front Camera Replacement

Proactive

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	Encore GX	2024 - 2025	All	All	All	All
Buick	Envista	2024 - 2025	All	All	All	All
Chevrolet	Trailblazer	2024 - 2025	All	All	All	All
Chevrolet	Trax	2024 - 2025	All	All	All	All

Involved Region or Country	North America
Additional RPO's	KSG, TQ5
Condition	<p>Customer may comment that they cannot switch between adaptive and regular cruise or cruise control is inoperative.</p> <p>Customer may also comment that the Intellibeam headlamp feature is also inoperative.</p> <p>These conditions may be present after the front camera module was replaced.</p>
Cause	Front Camera Module was not SPS configured after programming.

Correction:

Confirm vehicle will not switch between adaptive cruise and regular cruise by pressing and holding the cruise control cancel button.

If this fails, the technician will need to run the SPS Front Camera configuration.

Version History

Version	1
Modified	05/01/2024 - Created on.



GENERAL MOTORS

© 2024 General Motors. All Rights Reserved.