



Bulletin No.: PIT6163A
Published date: 05/10/2024

Preliminary Information

PIT6163A Instrument Cluster or HUD Blank at Times

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	XT5	2024	All	All	All	All
Cadillac	XT6	2024	All	All	All	All

Involved Region or Country	North America
Condition	<p>A vehicle may be encountered with the Instrument cluster DIC, HUD and/or steering wheel controls inoperative.</p> <p>Any or all of these issues may be found: No communication with IPC, headlight status inoperative, turn signal indicator inoperative, fuel range display inoperative, TPMS display inoperative, transmission range indicator inoperative, and odometer not displayed.</p> <p>Most steering wheel controls may be inoperable, but the heated steering wheel may still be functional.</p> <p>The cluster may not recover after an ignition cycle.</p> <p>When the concern is occurring the speedometer and tachometer will still function properly.</p>

Correction:

Using GDS2 go into P16 Instrument Cluster>Identification Information>End model part number.

If the part number is 86509056 and any of the above concerns are noted replace the P16 Instrument Cluster.

If the part number is not 86509056 follow SI diagnostics for the concern noted.

Version History

Version	2
Modified	05/03/2024 - Created on. 5/10/2024- Changed correction to add part # 86509056.



GENERAL MOTORS

© 2024 General Motors. All Rights Reserved.