



Bulletin No.: PIT6163

Published date: N/A

# Preliminary Information

## PIT6163 Instrument Cluster or HUD Blank at Times

### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	XT5	2024	All	All	All	All
Cadillac	XT6	2024	All	All	All	All

Involved Region or Country	North America
Condition	<p>A vehicle may be encountered with the Instrument cluster DIC, HUD and/or steering wheel controls inoperative.</p> <p>Any or all of these issues may be found:          No communication with IPC, headlight status inoperative, turn signal indicator inoperative, fuel range display inoperative, TPMS display inoperative, transmission range indicator inoperative, and odometer not displayed.</p> <p>Most steering wheel controls may be inoperable, but the heated steering wheel may still be functional.</p> <p>The cluster may not recover after an ignition cycle.</p> <p>When the concern is occurring the speedometer and tachometer will still function properly.</p>

### Correction:

**Test power and ground to IPC.**

**Test for loose, bent or backed out terminals.**

**If no circuit or terminal faults are found, replace the P16 Instrument Cluster**

### Version History

Version	1
Modified	05/03/2024 - Created on.



GENERAL MOTORS

© 2024 General Motors. All Rights Reserved.