

REFERENCE:	TSB: 08-177-24 GROUP: 08 - Electrical	Date:	August 8, 2024	REVISION:	08-043-23 REV. B
VEHICLES AFFECTED:	2020 - 2022 (BV) Jeep Renegade This bulletin applies to vehicles built on or after August 25, 2020 (MDH 0825XX) and built on or before March 14, 2022 (MDH 0314XX) equipped with Auto Power Folding Mirrors (Sales Code LFF) and one of the following engines: <ul style="list-style-type: none"> • 2.4L I4 Zero EVAP M-AIR Engine (Sales Code ED8). • 1.3L I4 Turbo PHEV Engine (Sales Code EYG). 			MARKET APPLICABILITY: <input type="checkbox"/> NA <input checked="" type="checkbox"/> MEA <input type="checkbox"/> SA <input checked="" type="checkbox"/> IAP <input checked="" type="checkbox"/> EE <input type="checkbox"/> CH	
CUSTOMER SYMPTOM:	The power folding mirrors may intermittently not fold, or unfold.				
CAUSE:	Folding mirror switch				

This bulletin supersedes Technical Service Bulletin (TSB) 08-043-23 REV. B, date of issue July 27, 2023, which should be removed from your files. All revisions are highlighted with ****asterisks**** and include an updated RSU statement, LOP and additional Repair Procedure steps.

****This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 22-178, date of issue October 01, 2022. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.****

REPAIR SUMMARY:

This bulletin involves replacing the power folding mirror/window switch assembly.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
08-80-54-96	Switch and Bezel, Front Door - Replace and Perform Realignment (1 - Semi-Skilled)	6 - Electrical and Body Systems	0.2 Hrs.
Failure Code	ZZ	Service Action	

SPARE PARTS:

Qty	Part No.	Description	Notes
1 (AR)	735768399 - Enlarged Europe 7MS28LXHAA - Mopar	Switch, Power Folding	(Right Hand Drive)
1 (AR)	735768403 - Enlarged Europe 7MS33LXHAA - Mopar	Switch, Power Folding	(Left Hand Drive)

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RSU VIN list, perform the repair. If any vehicle not on the VIN list exhibits any of the symptoms listed above in the customer symptom section, perform the Repair Procedure.

REPAIR PROCEDURE:

NOTE: High Voltage power down is not needed for this repair.

1. Replace the driver door power folding switch assembly. Refer to the detailed service procedures available in DealerCONNECT> Service Library under: Service Info> 08 - Electrical / 8N - Power Systems / Power Windows / Switch, Power Window / Removal and Installation.

NOTE: **If the power mirror door switch was replaced previously, perform the mirror realignment procedure if not performed the last time.

2. Perform a mirror realignment by manually closing both mirrors from the open positions, to the closed positions.
3. Using the power mirror door switch, actuate both mirrors to the open position. This may have to be performed two times to realign the system.

NOTE: At the end of the mirror realignment procedure, a click and a vibration can be heard, this indicates that the procedure was successful.**

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.