



Preliminary Information

PIT6127A Super Cruise Inoperative with B126B Set Current

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	CT6	2018 - 2020	All	All	All	All
Cadillac	XT6	2022 - 2023	All	All	All	All
Chevrolet	Bolt EUV	2022 - 2023	All	All	All	All

Involved Region or Country	North America
Additional Options (RPO)	UKL
Condition	Customer complaint of super cruise inoperative. Tech will find code B126B set current.
Cause	K179 Digital Map Control Module needs to be updated.

Correction:

Do Not replace the K179 Digital Map Module- follow instructions below to update the module.
 Confirm the A11 Radio has the latest software via SPS programming and USB file transfer.
 Ensure vehicle Wi-Fi is turned on.
 Ensure Wi-Fi shared hotspot is turned on.
 Ensure customer has a valid functioning Onstar subscription and a valid Super Cruise subscription - Press the blue Onstar button and ask Onstar for status of subscription.
 Vehicle needs to be outside in an open area with a strong Wi-Fi signal. (not in a garage)
 Vehicle needs to be driven long enough to receive map updates.
 If the vehicle cannot be driven, an alternative is to place the vehicle outside in an open area with a battery maintainer leaving the ignition on for two hours. About every 15 minutes the brake pedal will need to be pressed.
 Map data normally takes about one hour to update.
Note: Customer needs to be advised that they must keep Wi-Fi and Wi-Fi shared hotspot turned on. If they do not do this super cruise will again shut down after 7 months due to no Map updates.

Warranty Information

Version History

Version	2
Modified	02/12/2024 - Created on. 05/13/2024- Added a note to confirm the radio has the latest software per Jessica Thoma, BQM.



GENERAL MOTORS

© 2024 General Motors. All Rights Reserved.