



Bulletin No.: PIP5985

Published date: 06/10/2024

Preliminary Information

PIP5985 P0326 P0331 Cycle Connector X160 Knock Sensor

Models

Brand:	Model:	Model Years:	VIN: from to	Engine:	Transmissions:
Chevrolet	Colorado	2023 - 2024	All	All 2.7 L2R and L3B	All
GMC	Canyon	2023 - 2024	All	All 2.7 L3B	All

Involved Region or Country	North America
Condition	MIL may be illuminated due to P0326 and or P0331 setting.
Cause	Connector X160 may have poor knock sensor circuit terminal connection or the connector is not fully seated.

Correction:

Unplug connector X160, visually inspect the terminals in the connector for anything abnormal.

If nothing abnormal is observed, reconnect X160 and make sure it is fully seated.

Road test the vehicle. After the road test, scan the vehicle to verify P0326 and or P0331 have run and passed even if the MIL is not illuminated.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4088398	Unplug and re plug X160 Connector	0.3 hr
*This is a unique Labor Operation for Bulletin use only.		

Version History

Version	1
Modified	06/10/2024 - Created on.

 GM Global Brands

© 2024 General Motors. All Rights Reserved.