



**Bulletin No.:** PIT6055D

**Published date:** 06/11/2024

## Preliminary Information

### PIT6055D HUMMER EV Service Driver Assist Message with DMS DTC: U3000 or B0126

#### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
GMC	HUMMER EV	2022 - 2024	All	12/11/2023	All	All
GMC	HUMMER EV SUV	2024	All	12/11/2023	All	All

<b>Involved Region or Country</b>	<b>North America</b>
<b>Condition</b>	<p>A customer may comment of a "Service Drivers Assist" message, upon inspection one or more of the following DTC's may be found in the K180 Drivers Monitoring System Module (DMSM).</p> <p><b>B0126 SYM 49 Current/History,</b></p> <p><b>U3000 SYM 44 Current/History,</b></p> <p><b>U3000 SYM 49 Current/History.</b></p> <p><b>Note: If you experience a Service Drivers Assist" message that does not have one of the following DTC's above, refer to normal SI diagnosis.</b></p>
<b>Cause</b>	<b>Software Anomaly</b>

#### Correction:

Reprogram the K180 Driver Monitoring System Control Module using the latest software available in SPS which is part of Techline Connect.

#### Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
2810865	K180 Driver Monitoring System Control Module Reprogramming with SPS	Use Published Time

**Version History**

Version	5
Modified	<p><b>09/12/2023 - Created on.</b>  <b>11/14/2023- Update PI to add software fix that is now available.</b>  <b>02/29/2024- Reinstated PI per request of the Brand Quality Manager.</b>  <b>05/10/2024- Updated PI to point the software fix to PIT6065 as part of a software package per BQM</b>  <b>06/11/2024- Update correction field</b></p>

 GM Global Brands

© 2024 General Motors. All Rights Reserved.