



Bulletin No.: PIT5918B

Published date: 06/18/2024

Preliminary Information

PIT5918B Driver Side Headlight and/or Turn Signal Lights Stuck on/off/flickering / Dead battery and/or Accessory Illuminated Emblem Inoperative

Product Investigation Review Required

Models

Brand:	Model:	Model Years:	VIN: from to	Engine:	Transmissions:
GMC	Sierra 1500	2020 - 2022	All	All All	All
GMC	Sierra 2500/3500HD	2020 - 2022	All	All All	All
GMC	Yukon Models	2021 - 2022	All	All All	All

Involved Region or Country	North America
Additional Options (RPO)	RN2, R88, or Dealer Installed Accessory
Condition	<p>Some customers may have one or more of the following concerns:</p> <ol style="list-style-type: none"> 1. Drivers Headlight stuck on causing a battery draw 2. Drivers Headlamp / Turn Signal / High Beam inoperative or flickering 3. Accessory Illuminated Emblem is inoperative
Cause	The cause of these concerns could be water intrusion from GM Accessory Illuminated Emblem, which connects inline with the Driver's Side Headlight.

Correction:

- If the GM Accessory Illuminated Emblem was disabled per the original version of this PI, then remove the illuminated emblem and harness. Next, replace it with a new GM Accessory Illuminated Emblem kit which has been redesigned, see parts section below for more info. Install all the components in the new emblem kit.

 
- If the vehicle is coming in for the first time with this issue, then perform the following.

Inspect for water intrusion/corrosion in the following areas:

1. At the GM Accessory Illuminated Emblem Connection(1), shown below.



2. At the Drivers side headlight connector and the inline GM Accessory Illuminated Emblem Harness (2), shown below.



3. - If water/corrosion is found, then perform all necessary repairs to the Headlamp connector on the Body Harness and clean the Headlamp Assembly terminals. Then remove the illuminated emblem and harness and replace it with a new GM Accessory Illuminated Emblem kit which has been redesigned, see parts section below for more info. Install all the components in the new emblem kit.

Note: The Headlamp assembly is not currently known to be a source of the water intrusion.

4. - If NO water/corrosion is found at any of the connectors, then the source of the issue is not the GM Accessory Illuminated Emblem and normal SI diagnostics will need to be followed.

Parts Information

For all colors except Black, order a new GM Accessory Illuminated Emblem kit.

For a Black GM Accessory Illuminated Emblem kit, make sure the part being ordered notes "DESIGN 2" in the EPC or Accessory Information Center under the "engineering tab", as shown below.



Warranty Information

For vehicles repaired under the Bumper to Bumper Limited Warranty coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
0588648*	Inspect, Clean, and Replace Illuminated Emblem Kit	0.9 Hrs.
Add	Add Replacement of Body Harness Pigtail Connector	0.5 Hrs.
Add	Add MY 20-22 J21 Sierra LD Replacement of Headlamp Assembly	1.8 Hrs.
Add	Add MY 22 J22 Sierra LD Replacement of Headlamp Assembly	1.3 Hrs.
Add	Add Sierra HD Replacement of Headlamp Assembly	1.1 Hrs.
Add	Add Yukon/Yukon XL Replacement of Headlamp Assembly	1.9 Hrs.
*This is a unique Labor Operation for Bulletin use only.		

Version History

Version	3
Modified	05/17/2022 - Created on. 03/06/2024 - Update to the correction, parts, and warranty sections. 06/18/2024 - Update to the Parts section.

 GM Global Brands

© 2024 General Motors. All Rights Reserved.