



SSM 52786 2019-2020 Transit Connect - False Overheat With Illuminated MIL And Diagnostic Trouble Codes (DTCs) P1299 Or P0217

Some 2019-2020 Transit Connect vehicles may exhibit a false overheat condition and illuminated malfunction indicator lamp (MIL) with DTCs P1299 and/or P0217 present. Prior to any diagnostics, disconnect the generator electrical connector C1558B and generator positive cable C1558A then secure properly for testing. If the concern is no longer present when the electrical connections are removed, replace the generator. Refer to Workshop Manual section (WSM) 414-02. If the concern is still present, reconnect the generator and refer to normal diagnostics in WSM section 303-03A or 303-03B. Use the Report a Vehicle Concern link at the bottom of the OASIS report to submit a report if this condition is found.