



Bulletin No.: PIT6033A

Published date: 06/27/2024

Preliminary Information

PIT6033A Diagnostic Tip - Clunk / Rattle / Squeak / Pop / Click Noise When Turning

Models

| Brand: | Model: | Model Years: | VIN: from to | Engine: | Transmissions: |
|---------------|-----------------|---------------------|-------------------------|----------------|-----------------------|
| Cadillac | Escalade Models | 2021 - 2024 | All | All All | All |
| Chevrolet | Suburban | 2021 - 2024 | All | All All | All |
| Chevrolet | Tahoe | 2021 - 2024 | All | All All | All |
| GMC | Yukon Models | 2021 - 2024 | All | All All | All |

| | |
|-----------------------------------|---|
| Involved Region or Country | North America |
| Condition | Some customers may comment on a clunk, pop, rattle, click, and/or squeak type noise from under the vehicle. In most cases, the noise can be duplicated when making full left and then full right turns, at slow speeds, in an open parking lot. This noise may sound like it is from the front of the vehicle, but it is coming from the rear. |
| Cause | The cause of this noise could be a loose rear sway bar link upper mounting bolt/nut, shown below. |



Correction:

Inspect the rear sway bar link upper mounting bolts/nuts for proper torque and if necessary torque to 74 lb. ft. (100 Nm).


Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

| Labor Operation | Description | Labor Time |
|------------------------|-----------------------------------|---------------------------|
| 8040550 | Rear Stabilizer Shaft Link | Use Published Time |

Version History

| | |
|-----------------|---|
| Version | 2 |
| Modified | 06/21/2023 - Created on. 06/27/2024 - Update to the Model years. |

 GM Global Brands

© 2024 General Motors. All Rights Reserved.