

REFERENCE:	TSB: 08-183-24 GROUP: 08 - Electrical	Date:	August 13, 2024	REVISION:	-
VEHICLES AFFECTED:	2023 - 2024 (BV) Jeep Renegade This bulletin applies to vehicles built on or after August 01, 2023 (MDH 0801XX) and on or before January 19, 2024 (MDH 0119XX).			MARKET APPLICABILITY:	
				<input type="checkbox"/> NA	<input type="checkbox"/> MEA
				<input type="checkbox"/> SA	<input checked="" type="checkbox"/> IAP
				<input type="checkbox"/> EE	<input type="checkbox"/> CH
CUSTOMER SYMPTOM:	Customers may comment on the following:				
	<ul style="list-style-type: none"> Center High Mounted Stop Lamp (CHMSL) holding water. 				
CAUSE:	Manufacturing issue				

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 24-117, date of issue August 13, 2024. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.

REPAIR SUMMARY:

This bulletin involves testing and possibly replacing the CHMSL if water is present inside.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
08-50-88-95	Lamp, Center High Mounted Stop (CHMSL) - Inspect (1 - Semi-Skilled)	6 - Electrical and Body Systems	0.2 Hrs.
08-50-88-96	Lamp, Center High Mounted Stop (CHMSL) - Inspect And Replace (1 - Semi-Skilled)	6 - Electrical and Body Systems	0.5 Hrs.
Failure Code	ZZ	Customer Concern	

SPARE PARTS:

Qty	Part No.	Description	Notes
1 (AR)	51953596 - EMEA 68247167AA - MOPAR	Lamp, Center High Mounted Stop	

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RSU VIN list, perform the repair. If any vehicle not on the VIN list exhibits any of the symptom listed above in the customer symptom section, perform the Repair Procedure.

This RSU only applies to vehicles on the RSU VIN list.

REPAIR PROCEDURE:

1. Inspect if there is any water in the CHMSL assembly [Fig. 1](#).



Fig. 1
Water Inside Lamp

2. Set the water jet to 120 BAR / (1740 PSI).
3. Position yourself at a distance greater than 40cm (16 inches).
4. Make six passes from right to left for 10 seconds.
5. Dry the CHMSL with compressed air and check for the presence of water inside the assembly.
6. Is water found in the CHMSL assembly?
 - YES>>> Proceed to [Step 7](#).
 - NO>>> This RSU does not apply. Use Inspect LOP (08-50-88-95) to close this active RSU.
7. Replace the CHMSL assembly. Refer to the detailed service procedures available in DealerCONNECT/ Service Library under: 08 - Electrical / 8L - Lamps and Lighting / Lamps/Lighting - Exterior / Lamp, Center High Mounted Stop / Removal and Installation.

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.