

## BR223/BR206 Oil level indicator in workshop mode is not correctly displayed

Topic number	LI54.30-P-073761
Version	5
Function group	54.30 - Instrument cluster, display instruments, hazard warning device
Date	8/14/24
Validity	Model series 223 from code 802 (modification year 2021) Model series 206 from code 802 (modification year 2021)
Reason for change	Added boot software part numbers to cause

### Complaint

The oil level is not correctly displayed while the instrument cluster display is in workshop mode.

The oil level is reported in an inverted fashion when a correction is carried out. I.e. instead of an instruction to refill the oil quantity, an instruction to reduce the oil level is displayed, or vice versa.

### Cause

Previous software release for instrument cluster control unit (N133/1)

Boot software A2239049101, A2239046801, A2239040802

### Remedy

Update instrument cluster control unit (N133/1) software using XENTRY Diagnosis

<b>Symptoms</b>
Power generation > Engine lubrication/oil cooling > Function > Oil level too high
Power generation > Engine lubrication/oil cooling > Function > Oil level too low
Overall vehicle > Cleaning system > Cleaning system indicator lamp > Washer fluid level > lit

<b>Operation numbers/damage codes</b>				
Op. no.	Operation text	Time	Damage code	Note
			820EB**	Enter LI number in the warranty claim text