



Service Bulletin


Bulletin No.: 24-NA-153

Date: August, 2024

TECHNICAL

Subject: Rear Seat Back Wrinkled/Wavy Appearance

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Camaro Con-vertible	2016	2024	—	—	All	All


Involved Region or Country	North America, Argentina, Brazil, Chile, Paraguay, Europe, Middle East, Israel, Palestine, Japan
Additional Options (RPOs)	Equipped with SEAT RR-FIXED SEAT BACK (RPO A62)
Condition	 <p style="text-align: right;">6713252</p> <p>Some customers may comment that the rear seat back leather covers are wavy or wrinkled and appear to be a loose fit.</p>
Cause	The rear seat covers may not have been properly stretched out either from poor installation at the factory or from a prior service repair.
Correction	Please follow the Service procedure below to tighten the cover around the base of the seat and eliminate the wavy/wrinkled appearance. Note: This procedure can be followed assuming no damage to the cover has been found.

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Service Procedure

The following tools are recommended for this procedure:


- Gloves
- Fiber Stick
- Steamer (if accessible) to help generate heat and relax the leather. Not required.

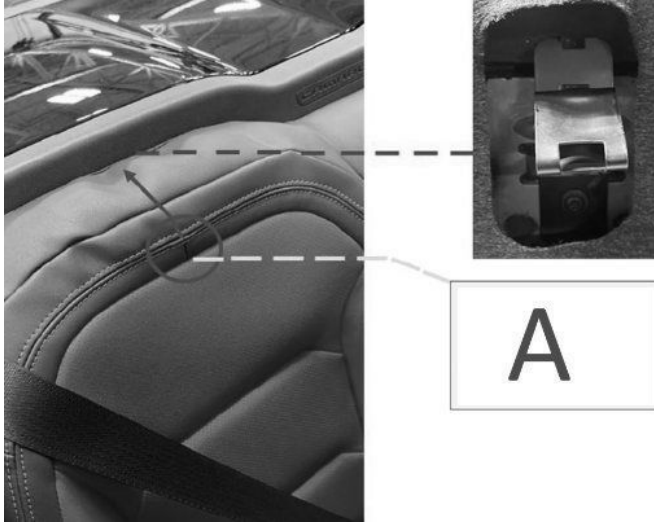

6713253

Note: (A) — Clip location is directly aligned to this center stitching area.

1. Locate the clip (bracket/latch). This can be found in the center of the RSB on the top.

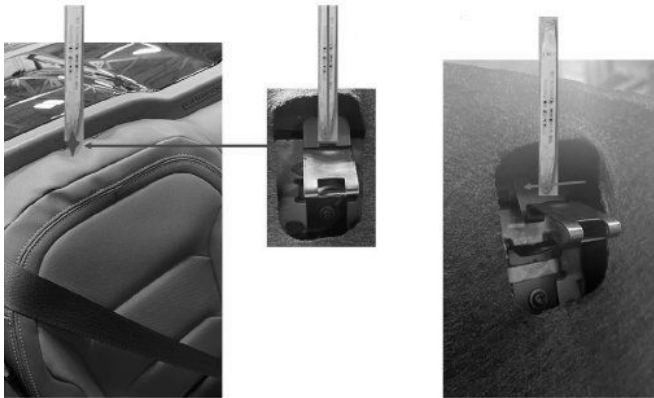

6713254

Note: Apply downward and inward force to get the brackets to release.

2. Using a fiber stick, un-latch the clip/bracket from the body of the vehicle.




6713255

3. Pull the RSB in towards yourself/down towards the RSC.



6713256

4. Finesse the RSB trim starting from the bottom working your way up and out to the sides and top. Once at the top, finesse over the back and down. (Apply steam if you need assistance/heat to help assist while finessing the leather/vinyl. Not required)

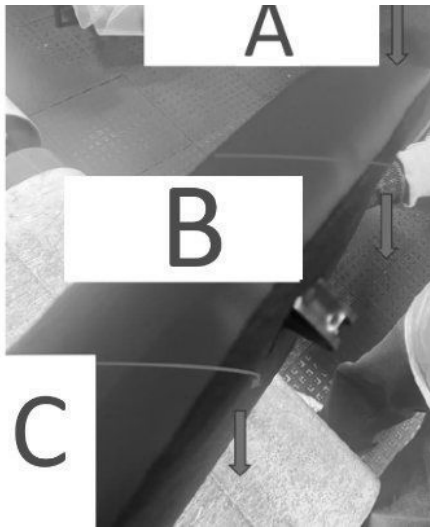

6713257

Note: (A) — Finesse the trim on the side in a downward motion.

Note: (B) — Massage from the front and roll the trim to the back and then in a downward motion.

Note: (C) — Continue from the top, working over the back and down.



6713258

5. When completed, firmly press the seat back until you hear an audible click. This lets you know that the RSB is properly seated, and the clips are locked/engaged.

Parts Information

No parts are required for this repair.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
7086048*	Re-Tighten the Rear Seat Back Cover	0.3 hr
*This is a unique Labor Operation for bulletin use only.		

Version	1
Modified	Released August 09, 2024

