

Technical Service Bulletin

Mazda North American Operations
Irvine, CA 92618-2922



Subject: WATER ENTRY INSIDE FRONT COMBINATION LIGHT	Bulletin No.: 09-041/24
	Last Issued : 08/30/2024

BULLETIN NOTES

This bulletin supersedes the previously issued bulletin(s) listed below. The changes are noted in Red text.

Previous TSBs:	Date(s) Issued:
09-041/18	11/13/18

APPLICABLE MODEL(S)/VINS

2016-2022 CX-3 (Japan built) vehicles with VINs lower than JM1 DK*****606638 (produced before July 11, 2022)
2023-2024 CX-3 (Mexico built) vehicles produced before Aug. 2024

DESCRIPTION

Some customers may notice water entry into the front combination lights (as shown below). This is due to poor sealing where rain or other water can enter inside the light. To eliminate this concern, the shape of the front combination light has been changed to improve sealing ability.



REPAIR PROCEDURE

1. Verify if the customer concern is dew condensation inside the lens or water entry from outside (water droplets found on inner surface of lens).

- If dew condensation is found, explain to the customer that this is a normal condition and is not a quality defect. Make

Page 1 of 2

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical--including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

no repair attempts.

- If water entry is found (as shown in the illustrations above), proceed to the next step.

2. Replace the affected front combination light unit(s) with modified part(s) according to instructions on MGSS online (FRONT COMBINATION LIGHT REMOVAL/INSTALLATION).
3. Verify the repair.

PARTS INFORMATION

Parts Number	Description	Qty.	Notes
DB4N-51-0K0A or DB4N-51-0K0B	UNIT(R), HEAD LIGHT	1	Halogen
DB4N-51-0L0A or DB4N-51-0L0B	UNIT(L), HEAD LIGHT	1	Halogen
DH5C-51-030C	UNIT(R), HEAD LIGHT	1	LED, 2018-2019MY
DH5C-51-040C	UNIT(L), HEAD LIGHT	1	LED, 2018-2019MY
DB4J-51-030G	UNIT(R), HEAD LIGHT	1	LED, 2016-2017MY
DB4J-51-040G	UNIT(L), HEAD LIGHT	1	LED, 2016-2017MY

NOTE: Refer to the GEPC to order the correct front combination light unit(s) for the subject vehicle.

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	77
Damage Code	9K
Part Number Main Cause	(SEE PARTS INFORMATION TABLE)
Quantity	1
Operation Number / Labor Hours:	XXP96ARX / 0.7 Hrs. (One side) XXP96BRX / 0.9 Hrs. (Both sides)

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical--including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.