



Service Bulletin

Bulletin No.: 22-NA-128


Date: August, 2024

TECHNICAL

Subject: Malfunction Indicator Lamp (MIL) Illuminated - DTC P0172, P026D, P2459, and/or P2A00 Set

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade Models	2022	2024				
Chevrolet	Silverado LTD (RPO J21, VIN Digit 5 = W/Y)	2022	2022			LM2, LZ0	
	Silverado New (RPO J22, VIN Digit 5 = A/D)						
	Silverado 1500	2025					
	Suburban						
	Tahoe						
GMC	Sierra Limited (RPO J21, VIN Digit 5 = 8/9)	2022	2022				
	Sierra New (RPO J22, VIN Digit 5 = H/U)						
	Sierra 1500	2023	2025				
	Yukon Models	2022					

Involved Region or Country	North America, Europe, Uzbekistan, Russia, Middle East, Israel, Palestine, Argentina (Mercosur), Bolivia (West), Chile (West), Colombia (West), Ecuador (West), Paraguay (West), Peru (West), Uruguay (West), Japan, Cadillac Korea (South Korea), Thailand (ASEAN), Australia/New Zealand
Condition	<p>Some customers may comment that the MIL is illuminated.</p> <p>Some technicians may find one or more of the following DTCs set in the Engine Control Module (ECM):</p> <ul style="list-style-type: none"> • P0172: Fuel Trim System Rich • P026D: Fuel Injection Quantity Too High • P2459: Particulate Filter Regeneration Frequency • P2A00: Heated Oxygen Sensor Performance

<p>Cause</p>	 <p>This condition may be caused by a leak at the intake manifold. 6102369</p>
<p>Correction</p>	<p>The technician can find this leak by testing using the <i>Component/System Leak Test in SI</i> or bulletin PIP5684. If a leak is found in the intake manifold, replace the intake manifold.</p>

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Service Procedure

Refer to *Intake Manifold Replacement in SI*.

Parts Information

Causal Part	Description	Part Number	Qty
X	MANIFOLD, INT	55511544	1

Warranty Information

For vehicles repaired under the Emission coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4088758*	Replace Intake Manifold for DTC P0172, P026D, P2459, and/or P2A00	6.3 hr (SUV)
		6.7 hr (P/U)
*This is a unique Labor Operation for Bulletin use only.		

Version	3
Modified	Released January 19, 2023 Revised May 29, 2024 - Added 2023 to 2025 to applicable vehicles and LZ0 to Engine section. Revised August 08, 2024 - Added 2025 to applicable vehicles.

