

WRL3 Stop Delivery - Check trailing arm on the rear axle (upper left) and replace if necessary

WRL3 Stop Delivery - Check trailing arm on the rear axle (upper left) and replace if necessary

ID Number	WRL3
Models	Cayenne (9YA/9YB)
Model Years	2024
VIN List	Attached
Number of Affected VINs	15
Issue Description	<p>Due to a process error in production, it is possible that incorrect axle control arms have been installed on the upper left rear axle of the affected vehicles. These components do not have the intended properties.</p> <p>For this reason, the axle control arm must be replaced before delivery to the customer, depending on the test result.</p> <p>Parts and solution are immediately available</p>
What Should Dealers Do	Please arrange for this measure to be performed immediately on the affected vehicles
TI	No. 119/24

Required parts

Part number	Designation	Quantity/vehicle	Parts return*
PAB505397	Transverse control arm	1 piece (only if required)	No
N 91228001	Hexagon flange bolt	4 piece (only if required)	No

WRL3 Stop Delivery - Check trailing arm on the rear axle (upper left) and replace if necessary

PAF912290	Cheese head bolt	1 piece (only if required)	No
PAF006496	Lock nut	1 piece (only if required)	No

Warranty processing

Scope 1: Checking upper left rear axle control arm

Damage number	WRL3 66 000
Repair Code	1
Labor time	28 TU

Scope 2: Checking and replacing upper left rear control arm - vehicles with air suspension

Damage number	WRL3 66 000
Repair Code	2
Labor time	602 TU

Scope 3: Checking and replacing upper left rear axle control arm - vehicles with steel suspension

Damage number	WRL3 66 000
Repair Code	2
Labor time	538 TU

Attachments

1. [WRL3 Stop Delivery VIN List V2 08.02.2024 HT.xlsx](#)