

# McLaren Artura Creaking From Rear Over Bumps

**This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.**

## Document Information

**Location:** Chassis / Suspension

**Topic:** Creaking from rear over bumps

**Condition:** Intermittent

**Diagnostic Trouble Codes:** N/A

## Measure

In the event creaking is audible from the rear of the vehicle when being driven over bumps, please inspect the following bush locations, ASSY LINK LOWER FORE and ASSY WISHBONE UPPER on both sides of the vehicle.

In order to test the vehicle in a static environment, it is recommended to apply an oscillating lifting force or bouncing motion to the rear upright, whilst monitoring the amount of movement and acoustics from the suspected suspension bush.

Please refer to the attached videos, displaying excessive noise emitted from a suspension bush.

If creaking is identified, please proceed to only replace the affected suspension arm.

## Parts Information

Affected part numbers:

16BA559CP - ASSY WISHBONE UPR RR RH

16BA557CP - ASSY WISHBONE UPR RR LH

16BA566CP - ASSY LINK LWR FORE LH

16BA567CP - ASSY LINK LWR FORE RH

## Attachments

ASSY LINK LOWER FORE creak

ASSY WISHBONE UPPER creak

**This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.**