



# Technical Service Bulletin

## 96 Audi active lane assist / lane departure warning - settings are not saved

96 24 02 2074842/1 August 9, 2024.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4, A4 allroad, S4, A5, A5 Cabriolet, A5 Sportback, S5, S5 Cabriolet, S5 Sportback, RS 5, RS 5 Sportback, Q5, Q5 e quattro, Q5 Sportback, SQ5, and SQ5 Sportback	2024	All	Not Applicable

### Condition

#### Customer states:

- The settings for steering input (late / early) and/or vibration warning (on / off) for the Audi active lane assist (PR #6I1) or lane departure warning (PR #6I3) are not saved.

#### Workshop findings:

- The complaint can be reproduced.

### Technical Background 1

Software issue in the front camera for driver assist systems -R242-.

### Production Solution

SW0093.

### Service

- Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions.*



# Technical Service Bulletin

- Update the Front Camera for Driver Assist Systems -R242- (Address Word 00A5) using the SVM action code as listed in the table below, if necessary:

Model	Old Software Part Number	Old Software Version	New Software Part Number (or higher)	New Software Version (or higher)	SVM Code Input
Q5	80A907217H	0091	80A907217K	0093	<b>A5A022</b>
A4/A5	8W0907217J		8W0907217L		
	8W6907217G		8W6907217J		
	8W7907217G		8W7907217J		

Update the front camera for driver assist systems -R242- (diagnostic address 00A5) via SVM. To enter the SVM code, use “Flash” mode on the ODIS tester. The SVM code is **A5A022**. Follow the instructions on the tester.

## Warranty

Warranty Number:	Service	9638		
Damage Code:	0039			
Labor Operations:	Software update	0151 0010	See SRT with associated operations	
	Software update	0151 0060	See SRT with associated operations	
Claim Comment:	As per TSB 2074842/1			

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



# Technical Service Bulletin

---

## Additional Information

All part and service references provided in this TSB (**2074842**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.