



Bulletin No.: PIT6201

Published date: 07/15/2024

Preliminary Information

PIT6201 Multiple Warning Lights on IPC

Models

 
Brand:	Model:	Model Years:	VIN:	Engine:	Transmissions:
Cadillac XT5	2024		from to	All All All	All

Involved Region or Country	North America
Condition	A vehicle may be encountered with a service steering message or other warning messages on the IPC and various codes. Codes may include B3981, P0700, U026A, U0121, U0131, U0136, U0140, U0146, U0216, U0422, U2099 or others may be found. Due to the number of circuits in the harness various other symptoms or codes may be encountered.
Cause	Harness beneath the center console chaffed.

Correction:


Inspect the harness in area shown below for chaffing on the bolt or bracket.

If damage is found repair the circuits and relocate the harness to prevent future damage.



Version History

Version	1
Modified	07/15/2024 - Created on.

 GM Global Brands

© 2024 General Motors. All Rights Reserved.