



Technical Service Bulletin

94 Warning in instrument cluster relating to exterior lighting/Audi adaptive light DTC: B126A29, U112100, U110B00

94 24 84 2074942/1 August 29, 2024.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q3	2022 - 2024	All	Not Applicable

Condition

Customer states:

- A warning lamp for the exterior lighting or Audi adaptive light is displayed in the instrument cluster. **No** fault is apparent in the lighting system.

Workshop findings:

The complaint can be reproduced. The following DTCs are stored in the onboard supply control unit J519 (diagnostic address 0009):

- B126A29** Light switch; implausible signal.
- U112100** Data bus missing message.
- U110B00** Light switch no communication.

All lighting functions are working.

Technical Background 1

Software issue.

Production Solution

Optimized software for model year 2025.



Technical Service Bulletin

Service

Check whether the situation is as described above. This phenomenon occurs very occasionally. Pressing the **“AUTO”** button will cause the warning lamp to go out and the DTCs to change to intermittent. The DTCs can then be erased.

If only DTC **“U110B00 Light switch no communication”** is stored without the others, the cause may be a loose connector, a pin that has been pushed back or a wiring problem.

Warranty

Claim Type:	<ul style="list-style-type: none"> If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only. 		
Service Number:	9405		
Damage Code:	0040		
Labor Operations:	GFF / Guided Functions	0150 0010	See SRT with associated operations
	GFF / Guided Functions	0150 0060	Time stated on the diagnostic protocol
Claim Comment:	As per TSB 2074942/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All part and service references provided in this TSB (**2074942**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval



Technical Service Bulletin

system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.