



Condition

ATTENTION:

**THIS IS A TECH TIP, NOT A TECHNICAL BULLETIN.
TECH TIPS ARE NOT ASSOCIATED WITH WARRANTY CLAIMING.**

Applicable Vehicles

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Atlas Atlas Cross Sport	2024	2.0T (DRKB)	All	All	All

Revision Table

Instance Number	Published Date	Version Number	Reason For Update
2075013/1	08/22/2024	15-24-02TT	Original Publication

Technical Background

Burrs on the cylinder head cover fasteners can cause the bolts to become loose, resulting in an oil leak from the cylinder head cover area.

See Figure 1 below for an example.



Figure 1.



15-24-02TT - Cylinder Head Cover Oil Leak

Release date: 8/22/2024

Service

Visually inspect the cylinder head cover fasteners for any signs of the fastener being loose. If any loose fasteners are found, replace the affected fastener(s) and tighten to 8Nm +90 degrees. Please ensure that replacing the fastener(s) remedies the oil leak.



It is NOT necessary to perform a reseal of the cylinder head cover, or replace the entire cylinder head for this concern, unless the above remedy is not successful.

Additional Information

© 2024 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.