

Missing Regen 'switch' menu on ICUC Screen

If a unit has an active SPN 5443 or SPN 3719 fault but driver cannot access the 'Start Regen' button – it is likely that the menu option has been disabled for some reason in the ICUC.

If you ever run into a P4 without the regen switch available in the dash menu – the option is in the ICUC parameters.

- PID 0x4001 (Vehicle Config):

Choose second option - A9614477521-002 DPF Regen Enabled.

+	📁 PID 0x40 (Vehicle config)	A0414477421-001	Default PID x40 (DTNA)
+	📁 PID 0x4001 (Vehicle config)	A9614478421-001	Defaultstring_PID 4001h Truck
	paramRockOutMode	(from parent)	disabled
	paramDPFRegen	(from parent)	disabled
	paramDPFInhibit	(from parent)	disabled
	paramTPMNewConcept	(from parent)	disabled
	paramDifflockNewConcept	(from parent)	disabled
	paramNightLight	(from parent)	disabled