



Bulletin No.: PIT6205

Published date: 07/22/2024

Preliminary Information

PIT6205 Diagnostic Tip: Take Steering Wheel Message Displayed After Image Process Module Replacement On Vehicles With RPO: 07Z

Models

Brand:	Model:	Model Years:	VIN: from to	Engine:	Transmissions:
Cadillac	Escalade Models	2022 - 2023	All	All All	All
Chevrolet	Suburban	2022 - 2023	All	All All	All
Chevrolet	Tahoe	2022 - 2023	All	All All	All
GMC	Yukon Models	2022 - 2023	All	All All	All


Involved Region or Country	North America
Additional Options (RPO)	07Z
Condition	Take Steering Wheel Message Displayed After Image Process Module Replacement On Vehicles With RPO: 07Z
Cause	<p>Vehicles built with RPO: 07Z are equipped with a dummy image processing module used only to complete the CAN bus communications circuits due to the vehicle not being equipped with Adaptive Cruise Control and Enhanced Auto Emergency Braking.</p> <p>If the dummy module needs to be replaced, they are not available and an actual Image processing module will have to be used which can cause this condition.</p> <p>Note: The replacement module does not require programming as it is just being used to complete the Can bus circuits.</p>

Correction:

To correct the concern, install the new Image processing module and then remove the 10A F23RA fuse from the rear fuse box to make the module non-functional. Next perform an Serial Data Gateway Configuration (SDAC) and clear all codes to resolve the concern.

Version History

Version	1
Modified	07/22/2024 - Created on.

 GM Global Brands

© 2024 General Motors. All Rights Reserved.