

**Technical Service Bulletin (TSB)**  
**Engine Starter Malfunction**

<b>REFERENCE:</b>	<b>TSB:</b> 08-194-24 REV. A <b>GROUP:</b> 08 - Electrical	<b>Date:</b>	September 7, 2024	<b>REVISION:</b>	08-194-24
<b>VEHICLES AFFECTED:</b>	<b>2024 - 2025 (B1) Jeep Renegade</b> This bulletin applies to vehicles built on or after <b>January 29, 2024 (MDH 0129XX)</b> and on or before <b>**July 22, 2024** (MDH 0722XX)</b> .			<b>MARKET APPLICABILITY:</b>	
				<input type="checkbox"/> NA	<input type="checkbox"/> MEA
				<input checked="" type="checkbox"/> SA	<input type="checkbox"/> IAP
				<input type="checkbox"/> EE	<input type="checkbox"/> CH
<b>CUSTOMER SYMPTOM:</b>	<b>Customers may comment on the following:</b> <ul style="list-style-type: none"> <li>Vehicle no start.</li> </ul>				
<b>CAUSE:</b>	Starter issue				

This bulletin supersedes Technical Service Bulletin (TSB) 08-194-24, date of issue September 04, 2024, which should be removed from your files. All revisions are highlighted with **\*\*asterisks\*\*** and include an updated build date and repair step starter build date.

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 24-123, date of issue September 04, 2024. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.

**REPAIR SUMMARY:**

This bulletin involves inspecting and possibly replacing the engine starter.

**CLAIMS DATA:**

Labor Operation No:	Labor Description	Skill Category	Labor Time
08-75-01-94	Starter, Engine - Inspect Build Date (1 - Semi-Skilled)	6 - Electrical and Body Systems	0.2 Hrs.
08-75-01-95	Starter, Engine - Inspect Build Date And Replace 4X2 Models (1 - Semi-Skilled)	6 - Electrical and Body Systems	1.0 Hrs.
08-75-01-98	Starter, Engine - Inspect Build Date And Replace 4X4 Models (1 - Semi-Skilled)	6 - Electrical and Body Systems	2.7 Hrs.
Failure Code	ZZ	Customer Concern	

## SPARE PARTS:

Qty	Part No.	Description	Notes
1 (AR)	7096882 - EMEA 68724324AA - MOPAR	Starter, Engine	

## DIAGNOSIS:

If a customer's VIN is listed in VIP or your RSU VIN list, perform the repair. If any vehicle not on the VIN list exhibits any of the symptoms listed above in the customer symptom section, perform the Repair Procedure.

**This RSU only applies to vehicles on the RSU VIN list.**

## REPAIR PROCEDURE:

1. Raise the vehicle on the hoist. Refer to the detailed service procedures available in DealerCONNECT/Service Library under: 04 - Vehicle Quick Reference / Hoisting / Standard Procedure.
2. Inspect the build date on the starter [Fig. 1](#).



**Fig. 1**  
Starter Build Date

3. Does it show a build date [Fig. 1](#) from \*\*January 23, 2024 (23/01/24) to February 27, 2024 (27/02/24)?\*\*
  - YES>>> Proceed to [Step 4](#).
  - NO>>> This RSU does not apply. Perform further diagnostics. Use Inspect LOP (08-75-01-94) to close this active RSU.
4. Replace the starter. Refer to the detailed service procedures available in DealerCONNECT/Service Library under: 08 - Electrical / 8F - Engine Systems / Starting / Starter / Removal / Installation.
5. Lower vehicle from hoist.

## POLICY:

Reimbursable within the provisions of the warranty.

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.*