



Bulletin No.: PIC6546A
Published date: 08/7/2024

Preliminary Information

PIC6546A Service Driver Assist Message

 
Models

Brand:	Model:	Model Years:	VIN: from to	Engine:	Transmissions:
Chevrolet Blazer EV	2024	All	All	All	All

Involved Region or Country	North America
Condition	Service Driver Assist message with no codes set
Cause	Possible open circuit to a haptic seat motor. 

Correction:
Connect GDS 2 to vehicle and enter diagnostics.
Go to B174W Front View Camera>Data Display>Front Impact Mitigation Disable History Data.
If Haptic Seat Alert Unavailable says yes use the scan tool to command the haptic seat

motors on.
If one of the seat motors is inoperative test power and ground to the inoperative motor.



If power or ground is missing repair or replace the seat harness as necessary.
If data does not show Haptic Seat Alert unavailable perform normal diagnostics of driver safety systems.

Version History

Version	2
Modified	04/17/2024 - Created on. 08/07/2024- Updated to add photos.