



Bulletin No.: PIT6144B

Published date: 08/8/2024

Preliminary Information

PIT6144B Diagnostic Tip for Service Leveling System Message And DTC: C1197 SYM92

Models


Brand:	Model:	Model Years:	VIN: from to	Engine:	Transmissions:
Cadillac	Escalade Models	2021 - 2024	All All	All	All
Chevrolet	Silverado EV RST	2024	All All	All	All
Chevrolet	Suburban	2021 - 2024	All All	All	All
Chevrolet	Tahoe	2021 - 2024	All All	All	All
GMC	HUMMER EV	2022 - 2024	All All	All	All
GMC	HUMMER EV SUV	2024	All All	All	All
GMC	Sierra Denali EV	2024	All All	All	All
GMC	Yukon Models	2021 - 2024	All All	All	All

Involved Region or Country	North America
Additional Options (RPO)	F47 Air Ride Adaptive Suspension
Condition	<p>Some customers may comment on following concerns:</p> <ul style="list-style-type: none"> - Air leveling suspension is inoperative - Service Leveling System message displayed in the DIC - DTC: C1197 SYM 92
Cause	This condition may be caused by a plugged or pinched air inlet hose to the air suspension compressor assembly.



Correction:

If you experience one of the conditions above, please check the following as this may be causing your concern:

Inspect the air suspension compressor air inlet hose for being pinched or twisted and preventing air from entering the air suspension compressor. The air inlet hose assembly is shown as #17 below. If you find the air inlet hose pinched or twisted, repair as needed.

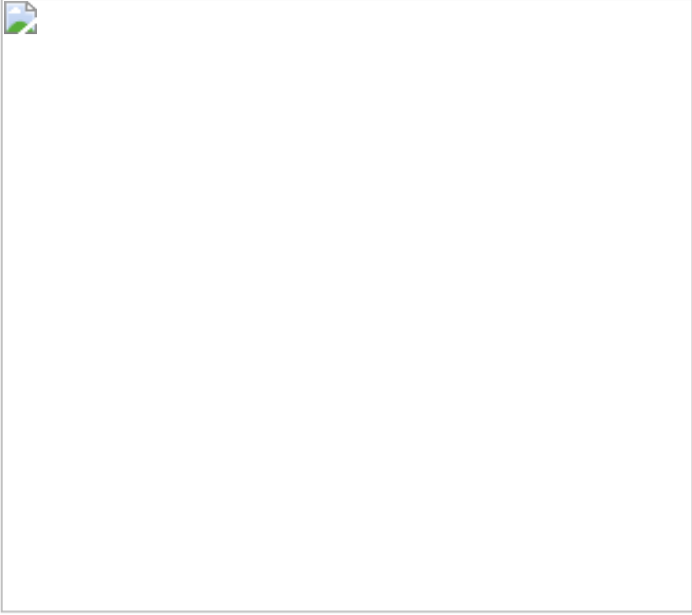

Example of twisted hoses on the 2024 Hummer EV SUV

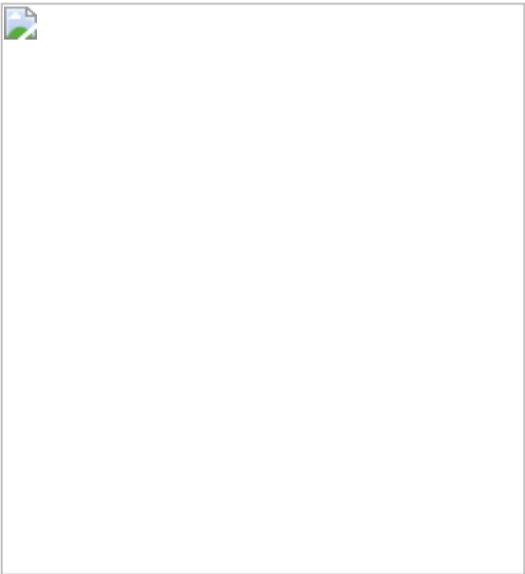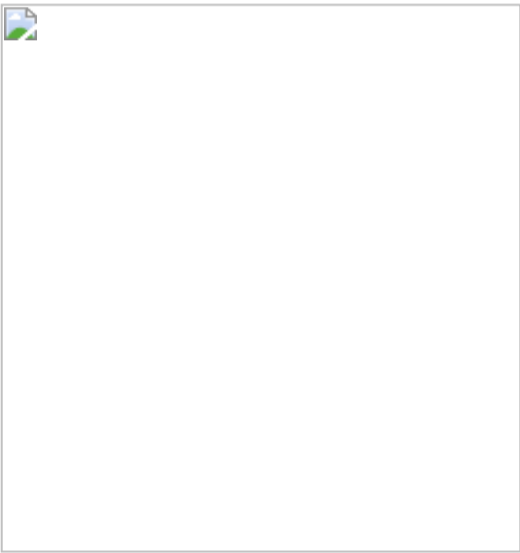


Example of a pinched hose on a 2023 Cadillac Escalade below:



2024 Silverado EV or 2024 GMC Denali EV may have a twisted hose near the inline air inlet filter. See Example below



The 2024 Hummer EV Pickup may have an kinked hose due to a air inlet hose fastener that is located in a incorrect mounting hole that restricts the air inlet hose. See Below:

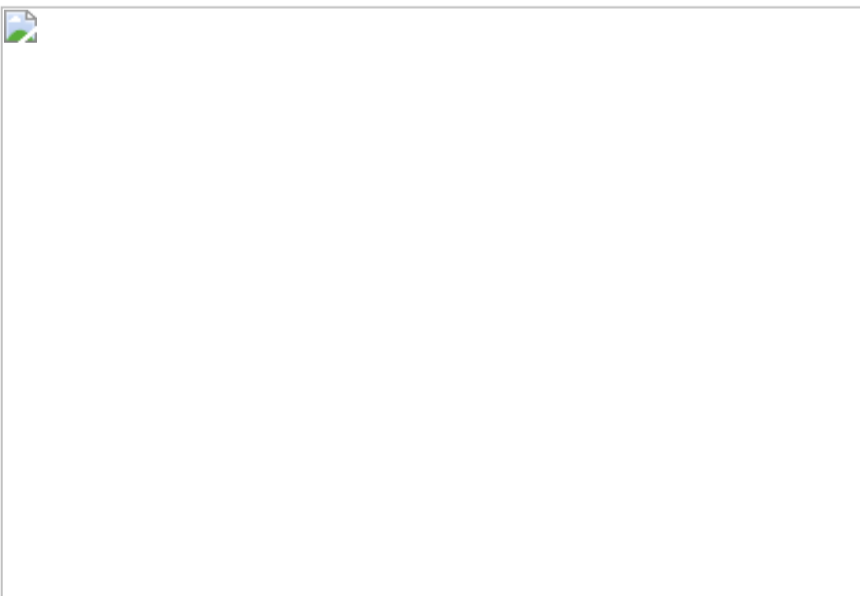


Locate the air suspension line assembly bracket in the right rear of the vehicle and make sure the air inlet line retainer is attached to the bracket as shown above in the locator hole

marked by # 2.

If the hose retainer is in location #1, it will restrict the air inlet hose and you will need to remove the retainer clip and install it in location #2.

Version History

Version	3
Modified	03/28/2024 - Created on. 06/21/2024- Updated the correct field to add photo of Hummer EV Pick up. 08/08/2024- Updated the correction field to add 2024 Silverado and Sierra EV vehicles.

 GM Global Brands

© 2024 General Motors. All Rights Reserved.