



Bulletin No.: PIP5998

Published date: 08/22/2024

Preliminary Information

PIP5998 Engine Oil Leak From Center Of Vehicle 2.7 L3B LR2

Models

Brand:	Model:	Model Years:	VIN: from to	Engine:	Transmissions:
Cadillac	CT4	2024	All	All 2.7 (RPO L3B)	All
Chevrolet	Colorado	2024	All	All 2.7 (RPO L3B, LR2)	All
Chevrolet	Silverado 1500	2024	All	All 2.7 (RPO L3B)	All
GMC	Canyon	2024	All	All 2.7 (RPO L3B)	All
GMC	Sierra	2024	All	All 2.7 (RPO L3B)	All

Involved Region or Country	North America
Condition	Some customers may comment that an oil leak can be seen coming from the center of vehicle. Some technicians may find oil leaking from the bell-housing area.
Cause	This condition may be caused by oil leaking past the rear crankshaft oil seal.

Correction:

If the oil leak has been verified to be coming from the rear crankshaft seal, replace the rear crankshaft oil seal and housing.

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.



Refer to Crankshaft Rear Oil Seal and Housing Replacement In Service Information.

Parts Information

Description	Part Number	Quantity
HOUSING, CR/SHF RR OIL SEAL	12737074	1
BOLT, A/TRNS FLEX PLT	11548684	8
GASKET, EXH SYS FRT	84407373	1
BOLT, RR S/ABS LWR BRKT	11561300	1
GASKET, O/PMP SUC PIPE	55487654	1
GASKET, TRFER CASE ADAP	24245110	1
BOOT, TRFER CASE FRT OUTPUT SHF	84124171	1
SEAL, TRNS CLR PIPE	85628205	1
OIL, ENGINE	Refer to EPC	As Required
SEALANT, RTV		1


Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
Use the Published Labor Operation	Crankshaft Rear Oil Seal Housing Replacement	Use the Published Labor Operation Time

Version History

Version	1
PIP5998	08/22/2024 - Created on.

 GM Global Brands

© 2024 General Motors. All Rights Reserved.