



Bulletin No.: PIP6001

Published date: 08/30/2024

Preliminary Information

PIP6001 Diagnostic Aid For No Service Information For DTC P08CB

Models

Brand:	Model:	Model Years:	VIN: from to	Engine:	Transmissions:
Chevrolet Express	2023 - 2024	All	All All	M5U MQD	
GMC	Savanna	2023 - 2024	All	All All	M5U MQD

Involved Region or Country	North America
Condition	Some Customers may complain of the check engine light on and various DTC'S setting.
Cause	Incorrect Software concern.

Correction:

The Technician may find DTC P08CB setting due to a software anomaly and will find no Diagnostic information.

Upon inspection they may find any of the following DTC'S P08CB, P0960, P0962, P0963, P0964, P0966, P0967, P0968, P0970 setting.

When using Service Information they may find that there is no diagnostic information available and/or the DTC description in Service Information does not match what the GDS2 is saying.

This is caused by a software anomaly.


Engineering is currently working on a correction and once found Service Information will be updated and this Preliminary Information will be removed.

Until that time please use the following table to accurately diagnose the vehicle.

If DTC P08CB is setting	Please use SI diagnostics for P0960
If DTC P0960 is setting	Please use SI diagnostics for P0962
If DTC P0962 is setting	Please use SI diagnostics for P0963
If DTC P0963 is setting	Please use SI diagnostics for P0964
If DTC P0964 is setting	Please use SI diagnostics for P0966
If DTC P0966 is setting	Please use SI Diagnostics for P0967
If DTC P0967 is setting	Please use SI Diagnostics for P0968
If DTC P0968 is setting	Please use SI Diagnostics for P0970
If DTC P0970 is setting	Please use SI diagnostics for P0971

Version History

Version	1
Modified	08/26/2024 - Created on.

 GM Global Brands

© 2024 General Motors. All Rights Reserved.