



STAR ONLINE PUBLICATION



Case Number: S2408000060


Release Date: September 2024 Rev. A

Symptom/Vehicle Issue: Check Engine Lamp (CEL) is on, Stop Start Inoperative, Air Conditioning (AC) Inoperative, No Start

Customer Complaint/Technician Observation: The owner complains of a CEL on, AC that is inoperative or Stop Start that does not operate. The technician observes one or more of the following Diagnostic Trouble Codes (DTCs) setting in the PCM.

P0058 - O2 Sensor 2/2 Heater Circuit High
P0158 - O2 Sensor Circuit High
P0038 - O2 Sensor 1/2 Heater Circuit High
P0138 - O2 Sensor 1/2 Circuit High
P141D - Starter Relay Feedback Circuit High
P2AF8 - Starter Relay -D- Control Circuit Low

Repair Procedure: Inspect the XY200A Black 34-way connector for any bent pins, spread and or Terminal Push Outs (TPOs) or signs or water intrusion. Clean, secure and replace any terminals as needed and secure the connector to complete.

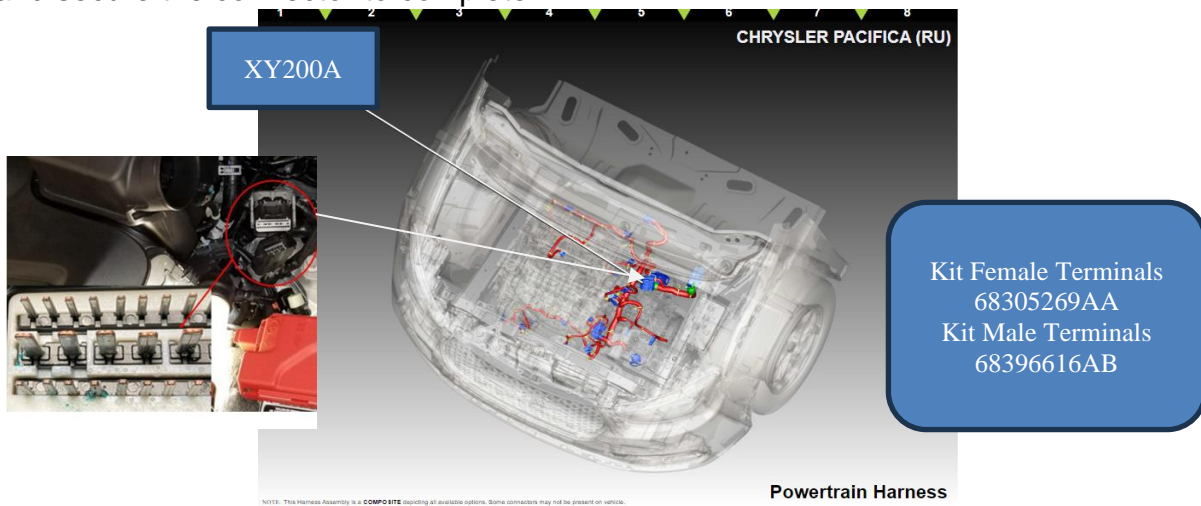

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechConnect, eCONTACT or Service Library entry if no solution is found.