



## **SSM 52853 2024 Mustang - IPC On-Demand DTC Self-Test Failures**

Some 2024 Mustang vehicles may exhibit an instrument panel cluster (IPC) concern where an IPC self-test may be required. When performing the IPC On-Demand DTC self-test, a "Test could not be started. Module programming may have failed" message may show and the IPC will be color coded as purple in the Ford Diagnosis and Repair System (FDRS) scan tool. To aid in diagnosing customer concerns, diagnostic trouble codes (DTCs) can be retrieved via the All-Continuous Memory DTC (ALL-CMDTC) self-test and normal Workshop Manual (WSM) diagnostics should be performed to address any DTCs present. The On-Demand DTC self-test communication error will not set any DTCs or affect vehicle operation and if this message is received, IPC replacement or reprogramming may not correct the concern. Inform customers that they can continue to drive the vehicle, and engineering is currently working on a solution for this condition that is expected in October 2025. Monitor the Professional Technician System (PTS) for updates.