



SSM 52863 2024 Ranger - Windshield Washer Fluid Reservoir Fill Neck Leaking At The Reservoir To Neck Seal

Some 2024 Ranger vehicles may experience a washer fluid leak originating from the windshield washer reservoir to windshield washer fluid reservoir fill neck. This may be due to the windshield washer fluid reservoir fill neck's horizontal surfaces being warped. To address this condition, replace the windshield washer fluid reservoir fill neck with the latest part. Before installing the new filler neck, inspect the filler neck opening that attaches to the windshield washer reservoir to make sure that the horizontal surfaces are straight and not warped. A windshield washer fluid reservoir fill neck with warped horizontal surfaces will leak and should not be used. Refer to the Workshop Manual, Section 501-10. For claiming, use causal part 17A605 and applicable labor operations in Section 12 of the Service Labor Time Standards (SLTS) Manual. If labor times are not available, claim M-time.