



# Service Bulletin

Bulletin No.: 24-NA-172

Date: August, 2024

## TECHNICAL

**Subject: Intermittent No Power or Vehicle will Hesitate DTC P0700, P0EFF, U1611, U0401**

| Brand:    | Model:   | Model Year: |      | VIN: |    | Engine: | Transmission: |
|-----------|----------|-------------|------|------|----|---------|---------------|
|           |          | from        | to   | from | to |         |               |
| Chevrolet | Colorado | 2024        | 2024 | -    | -  | All     | All           |
| GMC       | Canyon   |             |      |      |    |         |               |

|                                   |   |
|-----------------------------------|---|
| <b>Involved Region or Country</b> | North America, Middle East, GM Korea Company  |
| <b>Condition</b>                  | Some customers may comment on intermittent no power or will hesitate.<br>During this concern, the "D" and "L" will flicker on PRNDL and door locks cycle.<br>During diagnosis a technician may find DTC P0700, P0EFF, U1611, U0401. |
| <b>Cause</b>                      | The cause of the condition may be due to an unsecured ground G201A.   |
| <b>Correction</b>                 | If you encounter a vehicle with the above concern, clean and tighten the ground shown below.  |


**Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.**

**Service Procedure**

6719974

A - Fuse Junction Block

B - Ground that needs cleaned and tightened.

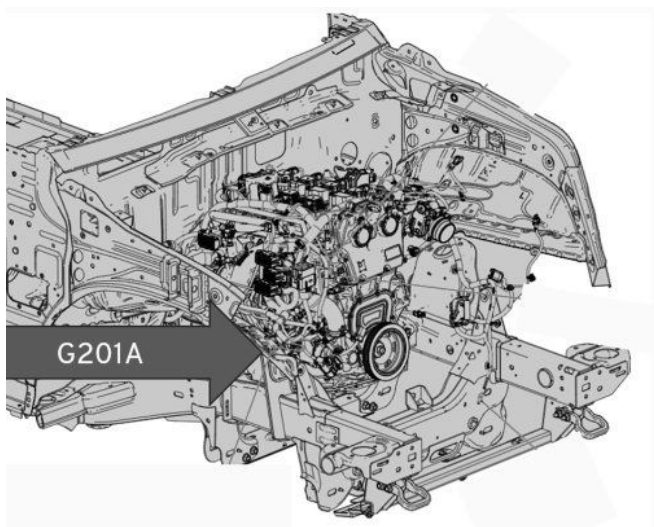

6719975

If you encounter a vehicle with the above concern, clean and tighten the ground shown above.

**Parts Information**

No parts are required for this repair.

**Warranty Information**

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

| Labor Operation  | Description                        | Labor Time |
|--|------------------------------------|------------|
| 5486048*   | Ground Connection Repair for G201A | 0.5 hr     |
| *This is a unique Labor Operation for Bulletin use only. |                                    |            |

|          |                          |
|----------|--------------------------|
| Version  | 1                        |
| Modified | Released August 26, 2024 |

