

MAS004328 RU 24-29

**RAPID UPDATE**

FROM: Maserati TSO

TO: Maserati Network



**Maserati**

PERSONAL SERVICE LAB

MASTERS OF CARE

# Rapid Update 739 Grecale - Upper Tailgate Spoiler Check



DATE: September 17, 2024

Certain Maserati Grecale (M182) MY24 listed in MODISCS+ are involved in a Rapid Update to check the bonding of the upper rear spoiler.

For a limited batch of vehicles, not enough glue may have been used to properly attach the painted part of the upper spoiler. This could cause visible gaps or areas that aren't fully adhered to, leading to unwanted noise and a noticeable cosmetic flaw. However, the spoiler is not at risk of detaching.

The procedure therefore involves checking the correct installation and possibly replacing the component with a new one.

We remind you that all the Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

**Please read and review this bulletin first before ordering parts and/or starting the procedure.**

Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions.

Thank You for your continued support and cooperation.

Maserati North America  
Aftersales Dept.


# Technical Procedure

 All images shown in this bulletin are for illustrative purposes only

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. The spoiler consists of two parts: a front piece matching the car's color and a black rear piece. Check both sides of the spoiler, using a 3.5 mm thickness gauge to verify the gap between the front (example: gray or white) and rear (black) components.



3. Measure the gap between the two components. **If the gap exceeds 3.5 mm**, the component is NOT compliant and must be replaced according to the instructions in the workshop manual.
  - **9.15.188 UPPER REAR DOOR SPOILER**      **Removal-Refitting or Replacement**

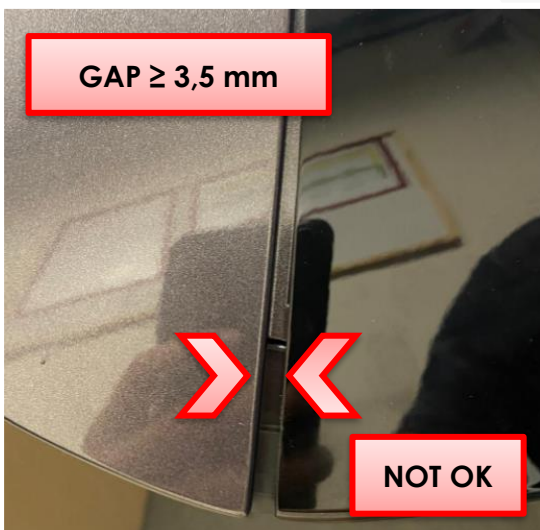

4. **If the gap is less than 3.5 mm**, the component is acceptable, and you may proceed with the inspection.
5. Open the vehicle's rear door and check the spoiler by applying upward pressure with your finger on the end of the rear (black) part of the spoiler.



6. If the component does not move, the component is **OK and compliant**, and **no further action is necessary**.

7. **If lifting** occurs, the **component is NOT OK (non-compliant)** and it is necessary to replace it, following the instructions contained in the workshop manual = **9.15.188 UPPER REAR DOOR SPOILER Removal-Refitting or Replacement**.



8. After the repairs, restore any components removed by following the procedure in reverse order.
9. Procedure complete.

## Spare Parts

Replace the component ONLY if the inspection results in **NOT OK**. Please order the following PNs:

Spare parts	QTY	PN
M182 SPOILER WHITE 240	1	670291779
OR		
M182 SPOILER GREY VR 035/B	1	670198021

## Warranty Claim

Complete the warranty request as follows:

Description	Code
Rapid Update number	739
Warranty code	23
Error code	063
Component Code	9.15.188
Operation Code	
<ul style="list-style-type: none"> <li>▪ Check</li> <li>▪ Rework</li> </ul>	9.15.188. A (0.10h) 9.15.188. B (0.50h)