

Subject: LOW WASHER FLUID LEVEL WARNING LIGHT COMES ON WITH WASHER FLUID IN THE TANK	Service Alert No.: SA-061/24
	Last Issued : 09/25/2024

BULLETIN NOTES

This Service Alert supersedes the previously issued SA(s) listed below. The changes are noted in Red.


Previous SAs:	Date(s) Issued:
SA-061/24	08/21/24

APPLICABLE MODEL(S)/VINS

2025 CX-70
2024-2025 CX-90

DESCRIPTION

Some customers may complain about a low washer fluid level warning message even though a visual inspection of the washer tank looks like it still has a fair amount of fluid in it. With the CX-90 and CX-70 introduction of the front-engine and rear-wheel-drive layout, the washer tank shape was changed from a vertical to a horizontal type. This makes it look like there is still enough liquid left if viewed from the spout when the warning light comes on.

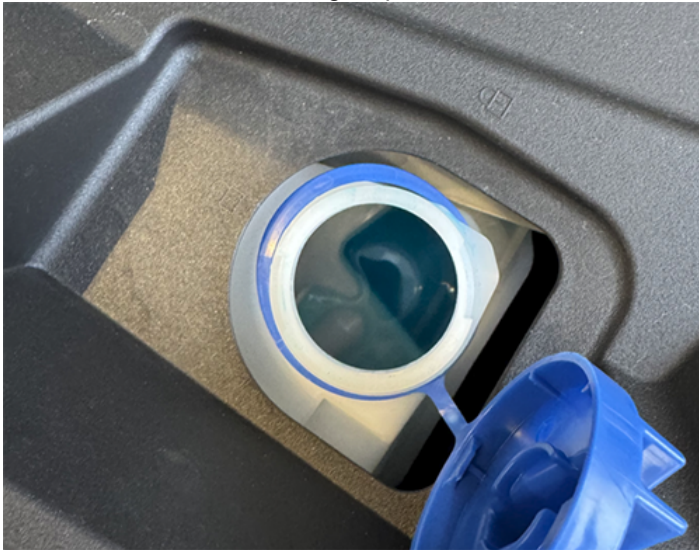

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

NOTE: The shape of the washer fluid tank cap has been changed from a pop-up type to a rotating type. When replenishing the washer fluid, **DO NOT** open the cap by pulling it, as it may be damaged. Open the cap by rotating it 90 degrees counterclockwise, as shown in the following figures.




Reference the Owner's Manual -
Replenishing Windscreen Washer Fluid

Closed

Opened

The warning light is designed to come on early so that the washer fluid does not run out at a short notice during long-distance driving. The light comes on when approximately 0.26 gallons (1.0 liter) of the washer fluid remains in this model, compared to 0.13 gallons (0.5 liters) for other models. The capacity of the washer fluid tank itself is 1.1 gallons (4.2 liters), and approximately 0.8 gallons (3 liters) should be replenished when poured to the FULL position (the edge of the spout).

Before attempting any repairs, first try filling the washer fluid tank to the spout line.

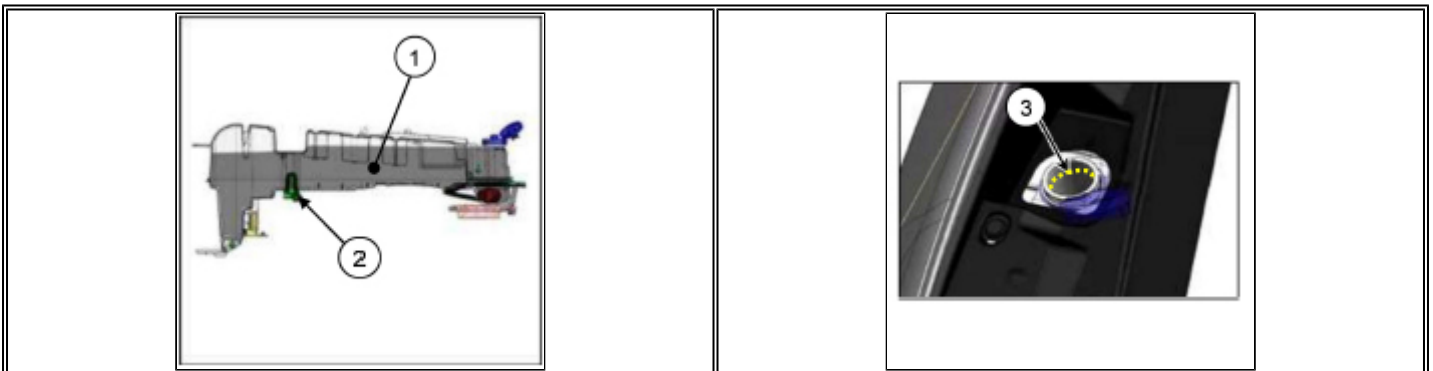

1. Washer fluid (shaded): filled with 1.1 gallons (4.2 liter)
2. Washer fluid level sensor
3. Full level of washer fluid: Fill washer fluid up to the line.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.