

**Problem Details:**


- M2+ and SD+ were configured incorrectly
- City horn sounds when park brake not set and door opened.
- Feature **NOT** requested by the customer or body builder **vehicle ordered with data code 275-998-NO EMERGENCY WARNING SIRENS**, yet **received functionality provided with data code 275-061- PARK BRAKE REMINDER WARNING SYSTEM**

**FSPRs, FRACAS, DPR, Zeus:**

- Customer complaint (no FSPR)

**Affected Models / Truck options:**

- Maximum impacted population: **8059** vehicles
- All M2+ and SD+

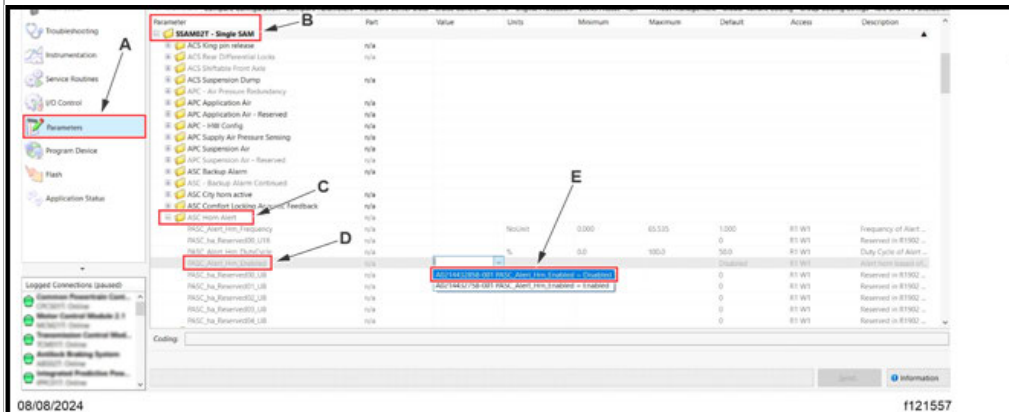

- A. Go to the 'Parameters' tab.
- B. Select and expand the 'SSAM02T - Single SAM' folder.
- D. Select the 'PASC\_Alert\_Hrn\_Enabled' parameter.
- E. Set the parameter value to 'A0214432858-001.'

**Production Containment:**

- Issue found in selection chart
- Maintenance release P22CAB-M1 addressed the charting problem

No  Yes

**Field Containment (short term):**

- Fix as fail

No  Yes

**Root Cause:**

- Engineering error with selection chart
- 275-998 needs to be charted differently from other options

No  Yes

**Long Term Corrective Action Plan:**

- N/A – handled with maintenance release

No  Yes

**Long Term Field Plan:**

- Service Bulletin 54-365 published 8/20/2024

No  Yes

