

MHEV DCDC INTERNAL FAILURE WITH WARNING MESSAGE

Customer Voice:

- 'Stop Safely Electrical Fault Detected' warning message on the instrument panel.

Technical Description:

- Internal failure in the 48V DCDC converter.
- Visible signs of damage to the connectors of the 48V DCDC converter and connector harness may also be present.

Status:

- Inspect the 48V DCDC converter for signs of damage to the connectors and harness, if damage is confirmed, renew the DCDC converter and harness.
- NOTE: This SSM is only applicable to vehicles installed with the following part numbers:
 - Service part number - Direct Current to Direct Current (DCDC) Converter 433123456 (N8B214B227AC)
 - Service part number - Harness 419123816 (R8E214N178AC)

Refer to SSM 76173 / 76174

Range Rover

- 22-24MY Range Rover
- 23-24MY RR Sport
- 20-24MY RR Velar

Defender

- 20-23MY Defender

Discovery

- 20-24MY Discovery
- 19-24 Discovery Sport

Jaguar

- 17-24MY F-PACE

