

**WRQ1 - Replacing Spreader Device (Actuator) (Stop Delivery)**

Model Line: **718 (982)**

Model Year: **As of 2024 up to 2025**

Concerns: **Spreader device (actuator)**

Cause: **There is a possibility that the spreader device (actuator) for the electric parking brake (EPB) does not meet the required specifications on the affected vehicles.**  
If this is the case, functional restrictions can potentially occur when the electric parking brake is used.

Action: Replacing right spreader devices (actuator)

Affected Vehicles: Only vehicles assigned to the campaign (see also PCSS Vehicle Information).

**Required parts**

Parts Info:	Part No.	Designation - Location	Quantity
	298609403	⇒ Spreader device (actuator) - <b>Right</b>	1 piece
	9A700704400	⇒ Fit bolt - Actuator mount	2 pieces
	N 10456004	⇒ Internal hexagon round countersunk screw, self-locking - Brake disc mount (PCCB)	2 pieces
	PAF009830	⇒ Internal hexagon round countersunk screw, self-locking - Brake disc mount (without PCCB)	2 pieces
	99907340201	⇒ Cheese head bolt (M12 x 1.5 x 72) - Brake calliper mount (without PCCB)	2 pieces
	9A700758500	⇒ Cheese head bolt (M12 x 1.5 x 85) - Brake calliper mount (with PCCB)	2 pieces

## Required Tools

- Tools:
- Torque spanner, 2-10 Nm (1.5-7.5 ftlb.), e.g. **V.A.G 1783 - torque wrench, 2-10 Nm (1.5-7.5 ftlb.)**
  - Torque spanner, 6-50 Nm (4.5-37 ftlb.), e.g. **V.A.G 1331A - torque wrench, 6-50 Nm (4.5-37 ftlb.)**
  - Torque spanner, 40-200 Nm (30-148 ftlb.), e.g. **V.A.G 1332A - torque wrench, 40-200 Nm (30-148 ftlb.)**
  - **P90999 - P90999 - PIWIS Tester 4**
  - Battery charger with a current rating of **at least 90 A**, e.g. **VAS 5908 battery charger 90 A**
  - Mounting bolts (wheel assembly)

## Replace right spreader device (actuator)

- Work Procedure: 1 Remove the spreader device (actuator) on the right.  
For this, see ⇒ *Workshop Manual '468519 Removing and installing spreader device (actuator)'*
- 2 Install **new** spreader device (actuator) on the right.  
For this, see ⇒ *Workshop Manual '468519 Removing and installing spreader device (actuator)'*
- 3 Enter the campaign in the Warranty and Maintenance Logbook.

## Warranty processing



### Information

The specified labor time was determined specifically for carrying out this campaign and includes all necessary preliminary work and rework.

The labor time may differ from the working times published in the Labor Operation List in the PCSS.

Scope 1: **Replacing right spreader devices (actuator)**

### Applies to vehicles

- **without** Porsche Ceramic Composite Brake (PCCB)
- **except** 718 GTS 4.0, 718 GT4, 718 GT4 RS and 718 Spyder

**Labor time:**

Replacing right spreader devices (actuator) Labor time: **140 TU**

Includes: Raising and lowering the vehicle on the lifting platform  
 Removing and installing rear right wheel  
 Removing and installing rear right parking brake shoes  
 Connecting and disconnecting battery charger  
 Connecting and disconnecting PIWIS Tester

**Required parts:**

298609403	Right spreader device (actuator)	1 piece
9A700704400	Fit bolt	2 pieces
N 10456004	Internal hexagon round countersunk screw	1 piece
99907340201	Cheese head bolt (M12 x 1.5 x 72)	2 pieces

⇒ **Damage number WRQ1 066 000 2**

Scope 2:

**Replacing right spreader devices (actuator)**

**Applies to vehicles**

- **718 25 Years of Boxster Edition, 718 GTS 4.0, 718 GT4, 718 GT4 RS and 718 Spyder**

**Labor time:**

Replacing right spreader devices (actuator) Labor time: **140 TU**

Includes: Raising and lowering the vehicle on the lifting platform  
 Removing and installing rear right wheel  
 Removing and installing rear right parking brake shoes  
 Connecting and disconnecting battery charger  
 Connecting and disconnecting PIWIS Tester

**Required parts:**

298609403	Right spreader device (actuator)	1 piece
9A700704400	Fit bolt	2 pieces
PAF009830	Internal hexagon round countersunk screw	1 piece
9A700758500	Cheese head bolt (M12 x 1.5 x 85)	2 pieces

⇒ **Damage number WRQ1 066 000 2**

Scope 3: **Replacing right spreader devices (actuator)**

**Applies to vehicles**

- **with** Porsche Ceramic Composite Brake (PCCB), **M-No. 450**
- **718 GT4 RS, 718 Spyder**

**Labor time:**

Replacing right spreader devices (actuator)

Labor time: **142 TU**

Includes: Raising and lowering the vehicle on the lifting platform  
 Removing and installing rear right wheel  
 Removing and installing rear right parking brake shoes  
 Connecting and disconnecting battery charger  
 Connecting and disconnecting PIWIS Tester

**Required parts:**

298609403	Right spreader device (actuator)	1 piece
9A700704400	Fit bolt	2 pieces
N 10456004	Internal hexagon round countersunk screw	1 piece
9A700758500	Cheese head bolt (M12 x 1.5 x 85)	2 pieces

⇒ **Damage number WRQ1 066 000 2**

**Important Notice:** Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2024 Porsche Cars North America, Inc.