

167 Air Conditioning Evaporator Leaking

Topic number	LI83.30-P-077763
Version	15
Function group	83.30 - Air conditioning
Date	10/1/24
Validity	167
Reason for change	Remedy

Complaint

Customer concern of Air Conditioning not cooling.

Cause

Possible refrigerant leak at the evaporator.

Remedy

Perform the following measures :

Remedy 1 (Only applies to vehicles produced during or prior to June 2023)

1. Picture of the forming gas check being performed with RO that shows the VIN clearly in view.
2. Clear picture of VIN on B-pillar.
3. Ensure that the rest of the AC system has been thoroughly checked for leaks before condemning the evaporator.

Remedy 2 (Applies to all 167's produced after June 2023)

1. Initial Quick Test
2. Create a short video of the actual pressures via AC machine, showing the engine running, and hold a copy of the VIN/RO in view as well.
3. Picture of the forming gas check being performed with RO that shows the VIN clearly in view.
4. OBS recording of XENTRY AC actual values of compressor request to be on and current value. (Instructions in Attachments)
5. Video recording of the leak being found via sniffer at the R/F AC drain after removing the under dash panel. (see attached videos)
6. If the evaporator is found to be leaking via sniffer, another video needs to be uploaded (or a continuation if only making the video after checks), showing the expansion valve being checked for leaks.
7. If no leaks are found with the sniffer at the expansion valve, spray soapy water mix on the expansion valve and check for leaks. Upload a video showing the spray test and VIN.
8. Open a TIPS case in the HV/LV inbox labeled "167 Evaporator Suspected of Leaking" with all attachments.

NOTE: (Applies to all 167's)

XENTRY Tips

- Please see the list of WIS documents for forming gas leak check and recharging of the system.
- All documents, with the exception of videos need to be uploaded for the warranty claim. Videos are only needed if a TIPS case is opened.
- Ensure that a full vacuum is pulled on the system for at least 30 minutes after replacement
- Condenser replacement is NOT authorized as a suitable repair in lieu of the dryer not being available.

Attachments	
File	Description
Expansion valve leak.mkv	
Leak at drain hose.mkv	
Using OBS Studio For Xentry Kits.pptx	

WIS-References		
Document number	Title	Note
AR83.30-P-1760ME	Drain, evacuate and recharge air conditioning, check for proper operation and check for leaks	Performing drain and refill
AR83.30-P-1761ME	Check air conditioning system for leakage	Must be done for all leak checks
AR83.30-P-1785ME	Flush air conditioning	Only to be performed if debris is found in the system
SI83.30-P-0021A	Service Information: Damage code	Notes for damage code to be used.

Disclaimer

NOTE: The information contained in this document is intended for use by trained, professional technicians with the knowledge to properly and safely perform diagnosis and repairs on Mercedes-Benz vehicles, using Mercedes-Benz approved tools and equipment. It informs service technicians about conditions that could occur in certain vehicles and provides information that could assist in proper vehicle diagnosis, service, or repair. It does not indicate that a defect is present in any vehicle referenced in this document nor does it imply warranty coverage. DO NOT assume that a symptom or condition, or a described cause of a symptom or condition, affects any particular vehicle or groups of vehicles, or that a described repair applies to any particular vehicle or groups of vehicles. There can be multiple causes resulting in the same or similar symptoms or conditions described in this document, and trained professional service technicians must use their diagnostic skills to make evaluations on a case-by-case basis. The information contained in this document does not guarantee warranty coverage nor does it extend the vehicle's warranty in any way.

Symptoms
Body > Air conditioning > Air conditioning > Insufficient cooling output

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
	Damage Code		8343204	Submit all claims under this damage code
540650	Battery Maintainer			
541011	Quick Test			

XENTRY Tips

826455	Extra work for left wiper			(only with code 874)
826456	Extra for right wiper			(only with code 874)
826890	Check wiper angle			(only if required)
831232	Video and pictures as required in Li			Up to 0.7hr allowable time.
831762	AC drain/fill/check			
832975	R&R cowl			