



# TECHNICAL SERVICE BULLETIN

## FHEV - Illuminated MIL With DTCs P0300, P0316 And/Or P051B Stored In The PCM

**24-2319**08 October  
2024**Model:**

Lincoln 2024 Nautilus
--------------------------

**Issue:** Some 2024 Nautilus vehicles equipped with a FHEV powertrain may exhibit an illuminated MIL with DTCs P0300, P0316 and/or P051B stored in the PCM. This may be due to the software level of the PCM. To correct this condition, follow the Service Procedure to reprogram the PCM to the latest software level via the FDRS.

**Action:** Follow the Service Procedure to correct the condition on vehicles that meet all of the following criteria:

- 2024 Nautilus equipped with an FHEV powertrain
- Illuminated MIL with DTC P0300, P0316 and/or P051B stored in the PCM

**Warranty Status:** Eligible under provisions of New Vehicle Limited Warranty (NVLW)/Emissions Warranty/Service Part Warranty (SPW)/Service Part New Vehicle (SPNV)/Extended Service Plan (ESP) coverage. Limits/policies/prior approvals are not altered by a TSB. NVLW/Emissions Warranty/SPW/SPNV/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

**Labor Times**

Description	Operation No.	Time
2024 Nautilus FHEV: Retrieve DTCs And Reprogram The Appropriate Modules As Required By The Software Update And Service Procedure (Do Not Use With Any Other Labor Operations)	MT242319	Actual Time

**Repair/Claim Coding**

Causal Part:	RECALEM
Condition Code:	04

**Service Procedure**

1. Connect a battery charger such as Rotunda GRX-3590 or DCA-8000 to the 12-volt battery.

**NOTE: To prevent the battery saver mode from activating on the vehicle, make sure the negative cable of the charger is installed on a chassis or engine ground, and not the 12-volt battery negative terminal. Do not have the vehicle plugged into high voltage battery charger during programming. This can cause incorrect module programming. Make sure only the 12-volt battery charger is installed.**

2. Reprogram the PCM and SOBDMC using the latest level software level of the FDRS scan tool. Follow all on-screen instructions carefully to complete all coordinated module software updates.

**NOTE: Advise the customer this vehicle is equipped with an adaptive transmission shift strategy which allows the vehicle's computer to learn the transmission's unique parameters and improve shift quality. When the adaptive strategy is reset, the computer will begin a relearning process. This relearning process may result in firmer than normal upshifts and downshifts for several days.**

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.