



Bulletin No.: PIT6230
Published date: N/A

Preliminary Information

PIT6230 Diagnostic Tip - A/C Inoperative or A/C Blows Warm Air



Models

Brand: Chevrolet Trax **Model:** 2024 **Model Years:** 2024 **VIN:** All **from to:** All All **Engine:** All All **Transmissions:** All


Involved Region or Country	North America
Condition	<p>Customers may comment their A/C system is inoperative or blows warm air.</p> <p>Technicians may find signs of oil/dirt located at the receiver/dryer cap.</p>
Cause	Some oil in this area should be considered normal due to assembly process. See examples below.

Correction:

Pictures below are examples of conditions that should be considered normal.

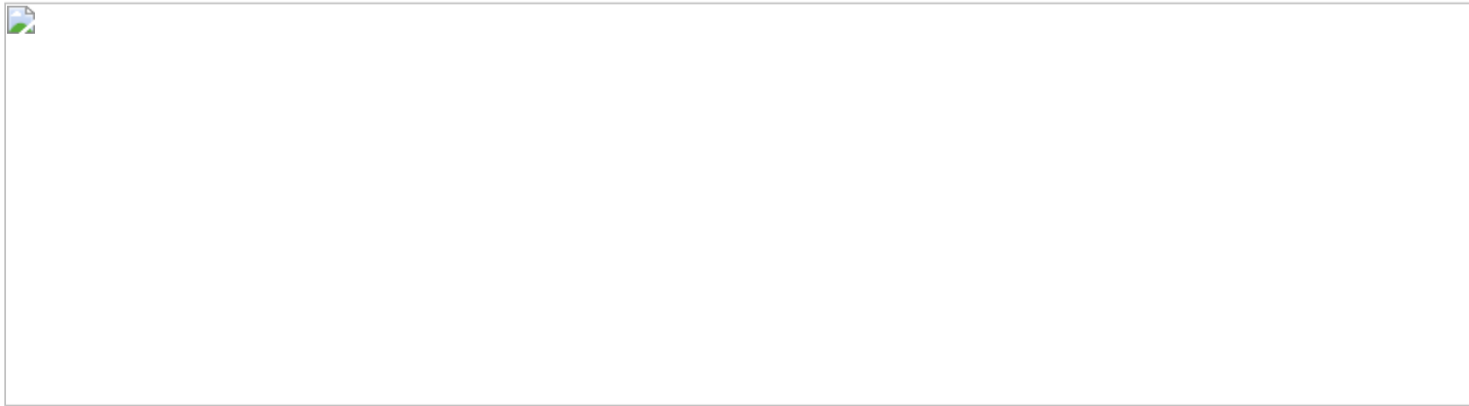 

 Technician should use the GE 50078 Electronic Leak Detector or GE 42220/J 42220 Universal 12V Leak Detection Lamp to confirm a leak in this area as shown in picture below.



Note: Only replace the component if evidence of a leak is found. Do NOT replace any components based on the evidence of dirt collection.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4417169	A/C System Analysis	Use standard published labor time

Version History

Version	1
Modified	09/03/2024 - Created on.