



Bulletin No.: PIT6235

Published date: 09/10/2024

Preliminary Information

PIT6235 MIL Illuminated-Various Warning Messages

Models

Brand: Chevrolet **Model:** Blazer EV **Model Years:** 2024 - 2025 **VIN:** All **Engine:** All **Transmissions:** All

Involved Region or Country	North America
Additional Options (RPO)	
Condition	Service high voltage message, shift to park message or others. May not shift out of park. Codes B2BBC B2BBD P0607 P0CC8 P1916 P1939 U11FD U164E U1961 may be set or other codes may be set. Any of these symptoms or codes or others may be displayed depending on which circuits are affected.
Cause	Harness chafed at edge of cowl causing damage to circuits.

Correction:

Inspect the harness in the area shown below for damage.

If damage is found, repair the circuits per SI.

Wrap the harness in tape or conduit and route it away from the cowl.








Warranty Information

Additional SI Keywords

24, 2024, B2BBC, B2BBD, Blazer EV, chafe, circuit, cowl, firewall, high, harness, P0607, P0CC8, P1916, P1939, rub, short, U11FD, U164E, U1961, voltage, warning, wear, worn

Version History

Version	1
Modified	09/10/2024 - Created on.

 GM Global Brands

© 2024 General Motors. All Rights Reserved.