



Bulletin No.: PIT6134D

Published date: 09/20/2024

Preliminary Information

PIT6134D Premature Front Brake Pad Wear

Models

Brand:	Model:	Model Years:	VIN: from to	Engine:	Transmissions:
Cadillac	Escalade Models	2021 - 2024	All	All	All
Chevrolet	Silverado 1500	2019 - 2024	All	All	All
Chevrolet	Suburban	2021 - 2024	All	All	All
Chevrolet	Tahoe	2021 - 2024	All	All	All
GMC	Sierra 1500	2019 - 2024	All	All	All
GMC	Yukon Models	2021 - 2024	All	All	All

Involved Region or Country	North America
Condition	<p>Some customers may comment that they are experiencing premature front brake pad wear.</p> <p>Typically, the brake pads may only last a few thousand miles after replacement.</p>
Cause	<p>The cause of this concern could be a change to the brake pad lining material starting mid year 2022.</p> <p>This change was made to help with brake pad noise but has been found to prematurely wear out under certain driving condition where the brakes can get very hot, like during mountainous driving or heavy city/stop and go traffic.</p> <p>NOTE: Vehicles built after mid 2022 model year and the GM replacement brake pads for all model years (2019-2024) are made of the new brake pad lining material, which may have premature brake lining life if driving in condition that get the brakes very hot.</p>

Correction:


If after inspecting the brake system and no other faults are found causing premature brake pad wear, then order new part level front brake pads part number **84847749**.

Important: Parts order must include VIN and will need to be escalated to ensure processing.

Refer to Front Disc Brake Pads Replacement in SI.

Version History

Version	5
Modified	03/15/2024 - Created on. 05/20/2024 - Update to the model years and Correction sections 07/19/2024 - Update to the cause and correction sections. 09/12/2024 - Updated to change part number. 09/20/2024 - Updated to change part number and include ordering instructions.

 GM Global Brands

© 2024 General Motors. All Rights Reserved.