



# Technical Service Bulletin

## 45 DTC B2F0100, U012700, U112200, and/or U112300 is stored in the ABS control module

45 24 47 2064758/4 September 10, 2024. Supersedes Technical Service Bulletin Group 45 number 22-28 dated November 2, 2022 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
e-tron GT, and RS e-tron GT	2022 – 2025	All	Not Applicable

### Condition

REVISION HISTORY		
Revision	Date	Purpose
4	-	Revised header (Added Model Year) Revised <i>Warranty</i> (Removed Warranty Table)
3	11/02/2022	Revised header (Added Model Year) Revised <i>Condition</i> (Symptom Code modified)
2	05/20/2022	Revised <i>header</i> (Added Model Year)

#### Customer states:

- No customer concerns, it is found during PDI or any other diagnostic work.

#### Workshop findings:

- The ABS/ESC warning lamp may flash in the instrument cluster when the diagnostic tester is connected. During PDI inspection the following DTCs might be found in the ABS control module, J104 (address word 0003):

- DTC B2F0100** (Development code 1) with symptom codes: 358656 (static) and 339457 (intermittent).

#### And/Or

- DTC U012700** (Tire Pressure Monitoring Control Module - no Communication) with symptom code 358656 (static).

In addition to one or more of the above DTCs, the below DTCs may also appear:

- DTC U112200** (Data bus implausible message) may be logged with symptom code 303616 (static).

#### And/Or

- DTC U112300** (Data bus error value received) may be logged with symptom code 169984 (intermittent) and with symptom code 303360 (static).





# Technical Service Bulletin

---

The static DTCs cannot be erased. The intermittent DTCs can be erased but will be logged again as soon as the conditions for them occur.

## Technical Background 1

The DTCs above are logged for design reasons (control module communication) but do not cause any issues for the customer. The function of the ABS/ESC is not altered or restricted by these DTCs.

## Production Solution

Not applicable.

## Service

No measure is necessary.

## Warranty

This TSB is informational only and not applicable to any Audi Warranty.

## Additional Information

All part and service references provided in this TSB (**2064758**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.