



Technical Service Bulletin

48 PSS: Yellow steering warning lamp on - DTCs B20000 and B200FF4 stored in the J500

48 24 70 2073087/2 September 10, 2024. Supersedes Technical Service Bulletin Group 48 number 24-62 dated February 19, 2024 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4, A4 allroad, S4, A5, A5 Cabriolet, A5 Sportback, S5, S5 Cabriolet, S5 Sportback, RS 5, and RS 5 Sportback	2024 – 2025	All	Not Applicable

Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised header (Add Model Year) Revised <i>Warranty</i> (Add Warranty Table)
1	02/19/2024	Initial publication

Customer states:

Upon starting the engine, the yellow steering warning lamp lights up and the power steering assistance is reduced.

Workshop findings:

The following DTCs may be logged in the steering control unit -J500- (diagnostic address 0044):

- **B200000** symptom 4176 and/or **B200FF4** symptom 16712020.

Or

- **B200000** symptom 4432.

Technical Background 1

Software issue.

Production Solution

Improved software planned for December 2024.



Technical Service Bulletin

Service

1. The DTCs will be set to passive in the next bus sleep cycle; the steering functionality will then no longer be restricted, and the steering warning lamp will no longer light up. The vehicle can be returned to the customer.
2. Explain to the customer that a software update is expected to be available by the end of Q4 2024 (subject to change) and that no repairs are necessary at this point. Do not replace any components for this condition since this will not resolve the customer's concern.
3. Create a PSS record in the PSS application through the Pending Service Solutions (PSS) link in AccessAudi (under *Related Links >> Service*).

NOTICE

Do not replace the steering, it will not fix the problem.

Warranty

Claim Type:	If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	4835		
Damage Code:	0040		
Labor Operations:	GFF	0150 0060	Time stated on the diagnostic protocol
	GFF	0150 0010	See SRT
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB 2073087/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All part and service references provided in this TSB (**2073087**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or



Technical Service Bulletin

transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.