



# Technical Service Bulletin

## 93 e-tron GT: stuck dog clutch with event memory entries P1D2E00, P1D4500, P1D2D00, P1C9800, P101E00 in 0001

93 24 15 2073490/2 September 18, 2024. Supersedes Technical Service Bulletin Group 93 number 24-57 dated May 28, 2024 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
e-tron GT, and RS e-tron GT	2022 – 2024	All	Not Applicable

### Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised <i>Service</i> (Updated measure)
1	05/28/2024	Initial publication

### Customer states:

- There is a Gearbox fault message shown in vehicle -> vehicle does not switch to second gear and max. speed is restricted to 74 mph.
- There are noises from the electric drive on rear the axle.
- The message “Gearbox malfunction: you can continue driving. Please contact workshop” or similar is displayed.

### Workshop findings:

- The customer statement can be confirmed.

The following DTCs and symptom code(s) is stored in *the Engine control module name -J623-*, (address word 0001) (relevant for procedure 1):

- **P1D2E00:** Claw coupling Time exceeded for display Symptom: 43976 passive/intermittent or active/static.
- **P1D4500:** Disk clutch 2nd gear Time exceeded for opening Symptom: 44008 passive/intermittent or active/static.



# Technical Service Bulletin

---

- **P1D2D00:** Claw coupling Display attempt failed Symptom: 43979 passive/intermittent or active/static.



**DTC entries P1D2E00, P1D4500 and P1D2D00 must occur in combination and are logged as both passive/intermittent and active/static.**

**DTC entries P1C9800 and P101E00 may also be logged and may be passive/intermittent or active/static (relevant for procedure 2):**

- **P1C9800:** Electrical transmission actuator blocked Symptom: 40335 passive/intermittent or active/static.
- **P101E00:** RPM limit due to excess temperature Symptom: 42659 passive/intermittent or active/static.

## Technical Background 1

The dog clutch is stuck radially.

## Production Solution

Not applicable

## Service

Check whether the dog clutch is still actively engaged, and the vehicle does not shift into 2nd gear. If this is the case, proceed as follows:



### WARNING

**Accelerate the vehicle from stationary to a maximum speed of 31 mph and perform a load change by pressing the accelerator. In parallel, please have a second person use an ODIS tester to check**



# Technical Service Bulletin

---

whether the vehicle shifts into second gear. If this is the case, the dog clutch was released successfully. The procedure can be aborted or repeated at any time.

## WARNING

Information texts relating to the road test/adaptation drive as shown at the start of the road test on the corresponding program on the ODIS Tester:

- Using application programs when driving can be distracting.
- Observe the road traffic regulations. They have priority over any driving instructions.
- Always perform a road test with a second person who operates the test equipment.
- Make sure that the test equipment in the vehicle does not distract the driver.

## WARNING

Danger due to the transport of unsecured test equipment.

- If the test equipment is transported unsecured or in the range of airbags, this could cause injuries in certain maneuvers or in the event of an accident.
- Make sure the test equipment is secured properly.
- Do not transport test equipment in areas in which airbags inflate.
- If possible, use test equipment on the rear seat bench. If there is no rear seat bench, keep test equipment flat on the passenger's lap. The passenger must operate the equipment. Move the passenger seat as far back as possible.

Work to perform for dog clutch (comprising of 2 sections):

### Section 1:

Software update for vehicle with campaign 91VT.

### Section 2:



# Technical Service Bulletin

---

Checking vehicle health based on event memory entries:

## There are two different procedures for identifying a stuck dog clutch on the e-tron GT:

### *Procedure 1:*

Identify the stuck dog clutch based on the following DTC entries:

- **P1D2E00:** Claw coupling Time exceeded for display Symptom: 43976 passive/intermittent and active/static.
- **P1D4500:** Disk clutch 2nd gear Time exceeded for opening Symptom: 44008 passive/intermittent and active/static.
- **P1D2D00:** Claw coupling Display attempt failed Symptom: 43979 passive/intermittent and active/static.

Check the frequency counter under “Standard ambient conditions” for the event memory entries given above.

→ If one of the DTC entries has a frequency count of 5 or more:

- Ask the customer whether the vehicle was parked on a slope before the fault occurred.
- If the vehicle is regularly parked on a slope, explain the recommendation to the customer (see information for customer).

**Perform Guided Fault Finding for the above DTC entries.**



**Please advise the customer that when parking on a slope the electromechanical parking brake should be activated before releasing the foot brake and leaving the vehicle.**



→ **In this case, it is not necessary to replace the electric drive motor for the rear axle.**



# Technical Service Bulletin

## Procedure 2:

Identify the stuck dog clutch based the following DTC entries:

- **P1D2E00:** Claw coupling Time exceeded for display Symptom: 43976 passive/intermittent and active/static.
- **P1D4500:** Disk clutch 2nd gear Time exceeded for opening Symptom: 44008 passive/intermittent and active/static.
- **P1D2D00:** Claw coupling Display attempt failed Symptom: 43979 passive/intermittent and active/static.

**In addition, the following DTC entries are also stored in diagnostic address 0001:**

- **P1C9800:** Electrical transmission actuator blocked Symptom: 40335 passive/intermittent and active/static.
- **P101E00:** RPM limit due to excess temperature Symptom: 42659 passive/intermittent and active/static.

If these DTC entries are also logged when the complaint occurs, check whether any noises occur or whether there are any large shavings (not abrasion particles) and/or pieces that have broken off in the gear oil.



**If noises occur and/or there are large shavings (not abrasion particles) and/or pieces that have broken off in the gear oil, replace the 2-speed rear axle transmission unit according to the instructions in the Workshop Manual.**

## Warranty

<b>Claim Type:</b>	<ul style="list-style-type: none"> <li>• If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.</li> </ul>		
<b>Service Number:</b>	9340		
<b>Damage Code:</b>	0010		
<b>Labor Operations:</b>	Drain and fill up gear oil	3401 1753	See SRT with associated operations



 
# Technical Service Bulletin

	Check gear oil	3401 0199	10 TU
	Remove and install gearbox	3435 1953	See SRT with associated operations
	Replace gearbox	3435 5553	See SRT with associated operations
	GFF	0150 0000	Labor according to the diagnostic log
	Charge Battery	2706 8950	See SRT with associated operations
	Test drive before the service procedure	0121 0002	10 TU
	Test drive after the service procedure	0121 0004	10 TU
<b>Claim Comment:</b>	As per TSB 2073490/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Required Parts and Tools

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.		
Part Number	Part Description	Quantity
See ETKA	Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA
See ETKA	Gear oil	See ETKA/ELSA
See ETKA	Gearbox	01



# Technical Service Bulletin

---

## Additional Information

All parts and service references provided in this TSB (**2073490**) are subject to change and/or removal.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.