



Service Bulletin

Bulletin No.: 24-NA-198

Date: September, 2024

TECHNICAL


Subject: Exhaust Fumes in Cabin and/or Loud Exhaust Noise

Brand:	Model:	Model Year:		Build Date:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade Models	2023	2024			LM2	
Chevrolet	Suburban						
	Tahoe						
GMC	Yukon Models						

Involved Region or Country	North America
Condition	Some customers may comment on exhaust fume gas smell inside the cabin and/or a loud exhaust noise.
Cause	This condition may be caused by A misalignment between the Nitrogen Oxides Catalytic Converter and Turbocharge.
Correction	Realign and re-torque the exhaust clamp.

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Service Procedure

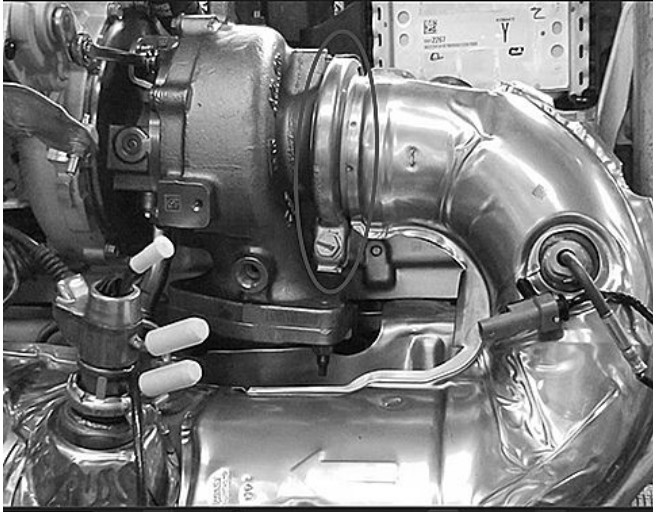

6736478

Inspect the connection between the Nitrogen Oxides Catalytic Converter and Turbocharge for exhaust leaks, Align the flange if necessary and torque the clamp to 12 N.m (106 lb in).

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4089268*	Realign and Torque the Exhaust Clamp	0.5 hr
*This is a unique Labor Operation for Bulletin use only.		

Version	1
Modified	Released September 18, 2024

