

Volvo Car USA LLC

Technical Journal

Technical Journal Title Key Fob Programming Failing		Ref. No. TJ 36889.2.0	
Issuer (Dept.) Technical Service		Issue Date 8/12/24	Status Date 9/5/24
Car Market United States and Canada	Partner 3 US 7510 Volvo Car USA	Function Group 3666	
Function Description Access (central looking & remote)		Page Page 1 of 2	

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

DESCRIPTION:

* If the car has SW 1.4 baseline or newer, you can now program a maximum of 2 key fobs. When programming key fobs to the car, follow advice under "Service."

CSC Customer Symptom Codes

Code	Description
1J	Remote control/Mechanical problem/Key unit only

DTC Diagnostic Trouble Codes

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
416							2024-9999		-	202336-999952

SERVICE:

* When pairing a new key card / or key fob during software download, please follow the steps below:

Note :

1. Remove all the Keys and NFC cards. Ensure that you have all the Keys and NFC cards from the customer.
2. Pair the key fobs (maximum of 2 fobs) as per the instructions for software download script.
3. Then pair the NFC key cards as per the instructions in software download script.

This sequence is important, if the cards are paired before the fobs, the 2nd fob will only be half-paired.

NFC - Near Field Communication

Technical Journal 36889.2.0

Warranty claim info:

No warranty claim is accepted for this TJ.

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support not needed", use function group 3666.